

AUBURN MUNI (AUN)(KAUN) 3 N UTC-8(-7DT) N38°57.29' W121°04.90'

SAN FRANCISCO

1538 B TPA—See Remarks NOTAM FILE AUN

L-2G, 3A

RWY 07-25: H3700X75 (ASPH) S-30 MIRL 1.2% up E

IAP

RWY 07: PAPI(P2L)—GA 3.0° TCH 21'. Thld dsplcd 200'. Hill.

RWY 25: PAPI(P2L)—GA 3.5° TCH 34'. Hill.

SERVICE: S4 **FUEL** 100LL, JET A, A1 **OX** 1, 2, 3, 4 **LGT** Rwy 25 PAPI unusable byd 5° left of centerline. **ACTIVATE** PAPI Rwy 07, MIRL Rwy 07-25—CTAF. PAPI Rwy 25 opr continuously..

NOISE: Rwy 25 no straight out added VFR dep. At end of rwy track 230 over self storage fac to avoid noise sensitive areas. Turn on crs after reaching 2500 MSL. Rwy 07 turn on crs after reaching 2500 MSL. Avoid noise sensitive areas. See noise abatement brochure.

AIRPORT REMARKS: Attended 1600-0200Z†. Fuel 100LL & Jet A avbl 24 hrs. Ultralight activity on and invof arpt. Helicopter TPA-2118(580). Rwy 07: Rft tfc: Hel right tfc for Rwy 07. Clsd tfc comply with aim proc. Min pwr while obsg safe acft ops. Tsnt prkg T's are painted blue. Lndg Fee: Refer to artp website for ovngt prkg fees.

AIRPORT MANAGER: 530-888-8174

WEATHER DATA SOURCES: AWOS-3 119.375 (530) 888-8934.

COMMUNICATIONS: CTAF/UNICOM 122.7

Ⓡ NORCAL APP/DEP CON 125.4

CLEARANCE DELIVERY PHONE: For CD ctc NorCal Apch at 916-361-6874.

RADIO AIDS TO NAVIGATION: NOTAM FILE TVL.


PALISADES (VL) (DH) VORV/DME 113.2 SWR Chan 79 N39°10.82' W120°16.18' 235° 40.3 NM to fld. 8850/16E.

VOR unusable:

036°-048° byd 40 NM

112°-124° byd 40 NM blo 14,000'

112°-124° byd 53 NM

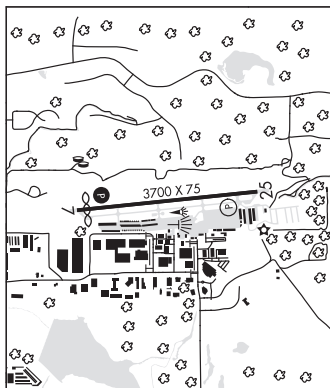

AVALON

CATALINA (AVX)(KAVX) 6 NW UTC-8(-7DT) N33°24.30' W118°24.95'

LOS ANGELES

1602 NOTAM FILE AVX

L-3E, 4G

RWY 04-22: H3000X75 (CONC) MIRL 1.8% up SW

IAP

RWY 22: REIL. PVASI(PSIL)—GA 3.0° TCH 39'. Rgt tfc.

SERVICE: **LGT** ACTVT REIL Rwy 22—CTAF. PSIL Rwy 22 opr drg arpt opreg hrs. Rwy 04-22 MIRL OTS indefly.

AIRPORT REMARKS: Attended 1600-0100Z†. Arpt CLOSED Thanksgiving and Christmas to all tntst fcs. Ops prohibited at night or when arpt is unatndd. No jet acft ops auth. Rwy 04-22 ltd by arpt opr to 12500 lbs mtow. Full stop ldg only; intxn tkofs prohibited. Rwy 04 final 2300 ft steep 2.1% downslope; Rwy 22 upslope preferred ldg. Pilots cannot see acft on opposite ends of rwy due to gradient, must annc taking active rwy on unicom prior to dep. Rwy 04-22 NSTD rwy safety areas. Ldg fee.

AIRPORT MANAGER: 310-510-0143

WEATHER DATA SOURCES: ASOS 120.675 (310) 510-9641.

COMMUNICATIONS: CTAF/UNICOM 122.7

Ⓡ SOCIAL APP/DEP CON 127.4

CLEARANCE DELIVERY PHONE: For CD ctc SoCal Apch at 800-448-3724.

RADIO AIDS TO NAVIGATION: NOTAM FILE HHR.

SANTA CATALINA (VL) (H) VORTACW 114.15 SXG Chan 88(Y)

N33°22.50' W118°25.19' 352° 1.8 NM to fld. 2090/15E.

VOR unusable:

040°-055° byd 40 NM


314°-360° byd 25 NM

TACAN AZIMUTH unusable:

314°-360° byd 25 NM

DME unusable:

314°-360° byd 25 NM

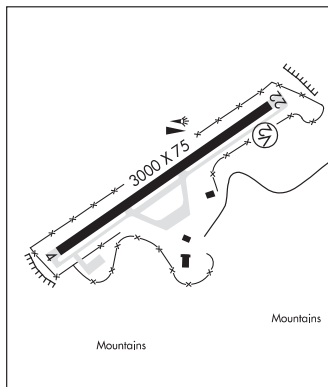

AVALON L11 N33°20.20' W118°18.67'/13

LOS ANGELES

AWOS-AV 119.275 (310) 510-0185

L-4G