

MOSES LAKE

GRANT CO INTL (MWH)(KMWH) 5 NW UTC-8(-7DT) N47°12.52' W119°19.15'

SEATTLE
H-1C, L-13A
IAP, AD

1189 B ARFF Index—See Remarks NOTAM FILE MWH

RWY 14L-32R: H13503X200 (CONC-GRVD) S-85, D-155, 2S-175,

2D-320, 2D/2D2-600 PCN 103R/B/W/T HIRL

RWY 14L: REIL. PAPI(P4L)—GA 3.0° TCH 75'. Bldg.

RWY 32R: MALSR. PAPI(P4L)—GA 3.0° TCH 76'. Rgt tfc.

RWY 04-22: H10000X100 (CONC-GRVD) S-75, D-100, 2S-127,

2D-175, 2D/2D2-475 PCN 92 R/B/W/T MIRL

RWY 04: REIL. PAPI(P4L)—GA 3.0° TCH 49'. 0.4% down.

RWY 22: REIL. VASI(V4L)—GA 3.0° TCH 50'. Rgt tfc. 0.3% up.

RWY 09-27: H3500X90 (CONC-GRVD) S-100, D-150, 2S-270,

2D-270, 2D/2D2-475 PCN 53 R/B/W/T RWY LGTS(NSTD)

0.3% up NW

RWY 27: Rgt t/c.

RWY 18-36: H3327X75 (ASPH) S-75, D-170, 2S-175, 2D-300,

2D/2D2-400 PCN 112F/A/W/T MIRL

RWY 18: Rgt tfc.

RWY 14R-32L: H2936X75 (CONC) S-100, D-200, 2S-175, 2D-400,

2D/2D2-400 PCN 107R/B/W/T

RWY 14R: Ground. Rgt t/c.

LAND AND HOLD—SHORT OPERATIONS

LDG RWY	HOLD-SHORT POINT	AVBL LDG DIST
RWY 04	14L-32R	4700
RWY 14L	04-22	7550
RWY 22	14L-32R	4650
RWY 32R	04-22	5050

RUNWAY DECLARED DISTANCE INFORMATION

RWY 04: TORA-10000 TODA-10000 ASDA-10000 LDA-10000

RWY 09: TORA-3500 TODA-3500 ASDA-3500 LDA-3500

RWY 14L:TORA-13503 TODA-13503 ASDA-13503 LDA-13503

RWY 14R:TORA-2936 TODA-2936 ASDA-2936 LDA-2936

RWY 22: TORA-10000 TODA-10000 ASDA-10000 LDA-10000

RWY 27: TORA-3500 TODA-3500 ASDA-3500 LDA-3500

RWY 32L:TORA-2936 TODA-2936 ASDA-2936 LDA-2936

RWY 32R:TORA-13503 TODA-13503 ASDA-13492 LDA-13492

SERVICE: S4 FUEL 100LL JET A. A1+ OX1 LGT ACTVT MALSR Rwy 32R: REIL Rwy 04: PAPI Rwy 14L—CTAF. Rwy

09-27 mil ldg zone lgts only.

AIRPORT REMARKS: Attended cont'd usdy. Rwy 09-27 CLOSED exc mil ops; C-17 assault strip. Not vis fm ATCT. Birds invof aprt apr and Oct. Rwy 14L conc tdy ftd 3240 ft; Rwy 32R conc tdy ftd 1490 ft. Class IV, ARFF Index A. PPR for air carrier ops with grtr than 30 pax seats 0600-1400Z+ - 509-762-5363. ARFF dep Index D H24. Twy F not vis fm ATCT. No edge intensity lgtg. Rwy 32R ftd 10,000' grnd lvs 500' wide. Twy G unlighted. Hvy mil frt netg training 0300-1100Z+. When ATCT clsd annnc Indg intns—CTAF. Fwy lgt trng svc to 5000' w/ 25 mi; psbl wake turbl frt Rwy 09-27 and Rwy 14L-32R. Acr twy mova area. All raprd flt mil acft cty—C509-762-2222 or 131.625 for svc one hr prior to Indg. Procd to trml ramp. Raprd flt avbl daltg dly. Ldg fee. Landing fees ovr 12,500.

AIRPORT MANAGER: 509-762-5363

WEATHER DATA SOURCES: ASOS 119.05 (509) 762-5082. LAWRS.


COMMUNICATIONS: CTAF 118.25 ATIS 119.05 UNICOM 122.95

MOSES LAKE RCO 122.4 (SEATTLE RADIO)

® GRANT COUNTY APP/DEP CON 126.4 (1400-0600Z±)

® SEATTLE CENTER APP/DEP CON 126.1 (0600-1400Z±)

TOWER 128.0 (WEST) 118.25 (EAST) (1400-0600Z±) GND CON 121.9

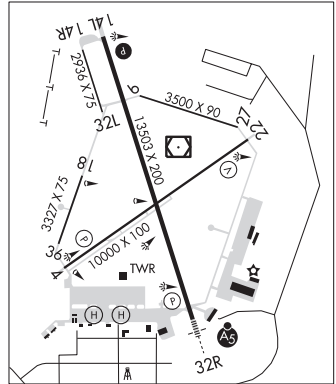

CONTINUED ON NEXT PAGE

