OKLAHOMA 243

WESTPORT (4F1) 2 E UTC-6(-5DT) N36°13.29′ W96°20.79′

901 TPA—1501(600) NOTAM FILE MLC

RWY 03-21: H2900X42 (ASPH) S-10, D-12.5 MIRL 1.0% up NE

SERVICE: LGT ACTIVATE MIRL Rwy 03–21—CTAF. Activate Rwy lgts for all ops day & night. Use highest ints for daytime ops.

AIRPORT REMARKS: Attended irregularly. Rwy 21 steep uphill slope up to +60′ hill at rwy end and 50′ right of centerline. Gross weight limited by airport operator to 6000 lbs single wheel gear.

AIRPORT MANAGER: 918-358-6031

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Tulsa Apch at 918-831-6714/6720.

WILBURTON MUNI (HØ5) 4 W UTC-6(-5DT) N34°55.21′ W95°23.63′

DALLAS-FT WORTH L-17D

KANSAS CITY

670 B NOTAM FILE MLC

RWY 17-35: H3000X60 (ASPH) S-2 MIRL

RWY 17: PAPI(P2L)—GA 3.0° TCH 40′. Trees.

RWY 35: PAPI(P2L)—GA 3.0° TCH 40'. Trees.

SERVICE: LGT ACTIVATE MIRL Rwy 17–35—CTAF.

AIRPORT REMARKS: Unattended. Deer on and invof rwy. Parl twy pavement failed; use south cnctr twy to apn.

AIRPORT MANAGER: 918-465-5361


COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at

817-858-7584.

RADIO AIDS TO NAVIGATION: NOTAM FILE MLC.

MC ALESTER (L) TACAN Chan 57 MLC (112.0) N34°50.97′ W95°46.94′ 069° 19.6 NM to fld. 782/8E.

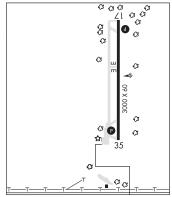

WILEY POST (See OKLAHOMA CITY on page 221)

WILLIAM R POGUE MUNI (See SAND SPRINGS on page 228)

WOODRING N36°22.43′ W97°47.29′ NOTAM FILE WDG.

(T) (T) VORW/DME 109.0~ ODG Chan 27~ at Enid Woodring Rgnl. 1150/8E.

RCO 122.6 (MC ALESTER RADIO)

WICHITA L-15D