

PONDER**HICKS** (74T) 2 E UTC-6(-5DT) N33°10.98' W97°15.28'**DALLAS-FT WORTH**

725 NOTAM FILE FTW

H-6H, L-17C**RWY 17-35:** 2364X90 (TURF)**RWY 17:** Bldg. Rgt tfc.**RWY 35:** Fence.**AIRPORT REMARKS:** Unattended. Tfc in the pat shall remain at or below 1,300 ft MSL. Rwy defined by mowing. 30 ft trees, 40 ft R and L of rwy cntrln. 6 ft washout along W side of rwy. Rwy rough and uneven. Arpt fenced. Gates locked. No public ingress or egress.**AIRPORT MANAGER:** 940-479-2114**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Regional Apch at 972-615-2799.**PORT ARANSAS****MUSTANG BEACH** (RAS)(KRAS) 2 SW UTC-6(-5DT) N27°48.71' W97°05.33'**BROWNSVILLE**

5 B NOTAM FILE RAS

L-20I, 21A, GOAW**RWY 12-30:** H3482X70 (ASPH) MIRL**IAP****RWY 12:** PAPI(P2L)—GA 3.0° TCH 20'.**RWY 30:** PAPI(P2L)—GA 3.2° TCH 22'. Tree.**SERVICE:** FUEL 100LL**AIRPORT REMARKS:** Attended irregularly. Parachute Jumping. 100LL 24 hr self serv. Rwy 12-30: rwy sfc seal-peastones.

Considerable amt of loose stones on rwy & twy. Rwy 12 has a -3 ft drop off near end of rwy, Rwy 30 has a 3 ft ditch 180 ft from end of rwy. Rwy 30 29 ft power line 1133 ft from thld left and right of centerline. 48 ft power line 1791 ft from thld left and right of centerline. Overnight tiedown fee.

AIRPORT MANAGER: 361-749-4008**WEATHER DATA SOURCES:** AWOS-3 118.425 (361) 749-0537.**COMMUNICATIONS:** CTAF 122.9**® CORPUS APP/DEP CON** 125.4**CLEARANCE DELIVERY PHONE:** For CD ctc Corpus Christi Apch at 361-299-4230.**RADIO AIDS TO NAVIGATION:** NOTAM FILE CRP.**CORPUS CHRISTI (VH) (H) VORTACW** 115.5 CRP Chan 102 N27°54.23' W97°26.69' 097° 19.7 NM to fld. 60/9E.

TACAN AZIMUTH & DME unusable:

024°-036° byd 35 NM blo 1,700'

037°-023° byd 35 NM blo 2,000'

265°-275°

VOR unusable:

340°-005° byd 40 NM blo 7,000'

340°-005° byd 84 NM

Byd 30 NM blo 1,500'

TACAN AZIMUTH unusable:

080°-085° byd 30 NM

PORT ISABEL-CAMERON CO (PIL)(KPIL) 10 NW UTC-6(-5DT) N26°09.97' W97°20.75'**BROWNSVILLE**

19 B NOTAM FILE PIL

H-7C, L-20H, 21A**RWY 13-31:** H8001X200 (ASPH-CONC) S-105, D-135, 2D-230 MIRL**IAP****RWY 13:** REIL. PAPI(P2L)—GA 2.0° TCH 27'.**RWY 31:** REIL. PAPI(P2L)—GA 3.0° TCH 41'.**RWY 08-26:** H5317X150 (CONC) S-50, D-60, 2D-110**RWY 08:** Fence.**RWY 26:** Trees.**RWY 03-21:** H5000X150 (ASPH-CONC) S-30, D-45, 2D-90**RWY 03:** Brush.**RWY 21:** Tree.**RWY 17-35:** H4200X75 (ASPH-CONC) S-30, D-45, 2D-90**RWY 35:** Tower.**SERVICE:** S2 FUEL 100LL, JET A QX2 LGT Rwy 13 REIL OTS. Rwy 31 REIL OTS.**AIRPORT REMARKS:** Attended 1400-2300Z. Parachute Jumping. 100LL & Jet A avbl self serve & full serv. Rwy 03-21 pavement has heavy grass encroachment. Rwy 08-26 rough pavement. Rwy has heavy grass encroachment. No position holding markings on numerous twys apchng rwy intersections. Loose gravel/pavement at intersection of Rwy 13 and northeast twy connecting Rwy 13 and Rwy 21. Rwy 03-21 and Rwy 08-26 markings faded.**AIRPORT MANAGER:** (956) 761-3700**WEATHER DATA SOURCES:** ASOS 118.525 (956) 233-1954.

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

COMMUNICATIONS: CTAF/UNICOM 122.8

® VALLEY APP/DEP CON 119.5

CLNC DEL 119.2

CLEARANCE DELIVERY PHONE: For CD ctc Corpus Christi Apch at 361-299-4230.

RADIO AIDS TO NAVIGATION: NOTAM FILE BRO.

BROWNSVILLE (H) (H) VORTACW 116.3 BRO Chan 110 N25°55.44' W97°22.52' 357° 14.6 NM to fld. 10/9E.

TACAN AZIMUTH unusable:

360°-290° byd 24 NM

DME unusable:

360°-290° byd 24 NM

VOR unusable:

271°-290° byd 20 NM

320°-335°

360°-270° byd 24 NM

PORT LAVACA

CALHOUN CO (PKV)(KPKV) 3 NW UTC-6(-5DT) N28°39.20' W96°40.96'

32 B NOTAM FILE PKV

RWY 14-32: H5004X75 (ASPH) S-26 MIRL

RWY 14: PAPI(P2L)—GA 3.0° TCH 45'. Road.

RWY 32: PAPI(P2L)—GA 3.0° TCH 45'. Road. Rgt tfc.

RWY 05-23: 2432X60 (TURF)

RWY 05: Tree.

RWY 23: Thld dsplcd 428'.

SERVICE: S4 FUEL 100LL, JET A LGT ACTVT MIRL Rwy 14-32—CTAF.

AIRPORT REMARKS: Attended 1400-2300Z†. 100LL and Jet A avbl 24 hrs self serve. Jet A also avbl by truck. RC model acft opr at Rwy 05 end.

AIRPORT MANAGER: 361-552-1228

WEATHER DATA SOURCES: AWOS-3 118.275 (361) 552-3060.

COMMUNICATIONS: CTAF/UNICOM 122.8

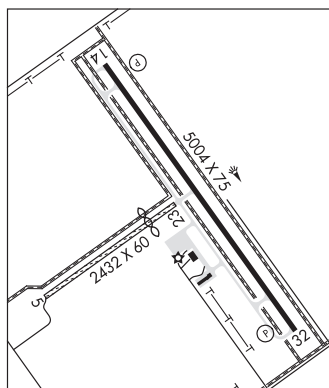
® HOUSTON CENTER APP/DEP CON 135.05

CLEARANCE DELIVERY PHONE: For CD ctc Houston ARTCC at 281-230-5622.

RADIO AIDS TO NAVIGATION: NOTAM FILE PSX.

PALACIOS (VH) (H) VORTACW 117.3 PSX Chan 120 N28°45.87'

W96°18.37' 244° 20.9 NM to fld. 16/8E.

HOUSTON
H-7C, L-201, 21A, GOAW
IAP

PORT MANSFIELD

CHARLES R JOHNSON (TØ5) 1 NW UTC-6(-5DT) N26°33.61' W97°26.36'

10 B NOTAM FILE SJT

RWY 12-30: H3200X50 (ASPH) S-21 MIRL

RWY 12: P-line.

RWY 30: P-line.

SERVICE: LGT MIRL Rwy 12-30 preset low intst; to increase intst ACTVT—CTAF.

AIRPORT REMARKS: Unattended. Harbor superintendent's ofc attended 1400-2250Z†. Deer & birds on & invof arpt. Rwy 12 and Rwy 30 rwy mkgs discolored. Fee for ovnght tie down.

AIRPORT MANAGER: 956-944-2325

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Corpus Christi Apch at 361-299-4230.

RADIO AIDS TO NAVIGATION: NOTAM FILE HRL.

HARLINGEN (VL) (DH) VORW/DME 113.65 HRL Chan 83(Y) N26°13.75' W97°39.14' 025° 22.9 NM to fld. 32/5E.

BROWNSVILLE
L-20H, 21A