

DURANGO—LA PLATA CO (DRO)(KDRO) 10 SE UTC-7(-6DT) N37°09.09' W107°45.23'

6689 B Class I, ARFF Index B NOTAM FILE DRO

DENVER
H-4K, L-8I, 9E
IAP

RWY 03-21: H9201X150 (ASPH-GRVD) S-95, D-150, 2S-175,

2D-210 PCR 880 F/D/X/T HIRL

RWY 03: MALSR. PAPI(P4L)—GA 3.0° TCH 55'. 0.8% up.

RWY 21: REIL. PAPI(P4L)—GA 3.0° TCH 51'. 0.7% down.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 03: TORA-9201 TODA-9201 ASDA-9201 LDA-9201

RWY 21: TORA-9201 TODA-9201 ASDA-9201 LDA-9201

SERVICE: S4 FUEL 100LL, JET A OX 4 LGT MALSR Rwy 03; REIL Rwy 21; HIRL Rwy 03-21 oper on photocell; incr/decr instst—CTAF. PAPI Rwy 03 and Rwy 21 on consly; incr/decr instst—CTAF.

AIRPORT REMARKS: Attended 1100-0700Z†. Aft hr—970-259-7400.

ARFF coverage prvdg durg acr tfc ops; otr times 24 hr PPR—arpt ops 970-759-4342. PPR for unskd acr ops with more than 30 pax seats—arpt ops 970-759-4342. HOP on and invof arpt. Cond unmon at ngt aft last acr arr until 1100Z†; see NOTAMS. Lndg fee applicable.

AIRPORT MANAGER: (970) 382-6051

WEATHER DATA SOURCES: ASOS 120.625 (970) 259-3579.

COMMUNICATIONS: CTAF/UNICOM 122.8

RCO 122.2 (DENVER RADIO)

RCO 122.6 (DENVER RADIO)

® **DENVER CENTER APP/DEP CON** 118.575

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC on freq. If una, ctc FSS on freq via rco. If una, ctc Denver ARTCC at 303-651-4257.

AIRSPACE: CLASS E svc 1300-0300Z†; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE DRO.

(VL) (DH) VORW/DME 116.55 DRO Chan 112(Y) N37°09.20' W107°44.98' at fld. 6662/14E.

VOR unusable:

004°-014° byd 40 NM blo 16,500'

004°-014° byd 50 NM

015°-070° byd 40 NM

131°-190° byd 40 NM

220°-225° byd 40 NM

250°-003° byd 40 NM

290°-310° byd 15 NM blo 17,000'


DME unusable:

070°-090° byd 30 NM blo 12,500'

140°-185° byd 25 NM blo 13,000'

290°-310° byd 15 NM blo 17,000'

ILS 109.1 I-DRO Rwy 03. Class IE.

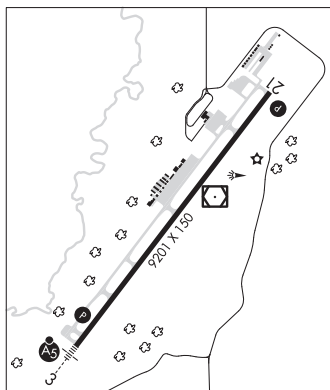

EADS MUNI (9V7) 1 W UTC-7(-6DT) N38°28.51' W102°48.65'

4245 NOTAM FILE DEN

WICHITA
L-10G

RWY 17-35: H3860X60 (ASPH) MIRL

RWY 17: Road.

RWY 35: Road.

AIRPORT REMARKS: Unattended. Be alert, intensive USAF student training invof Colorado Springs and Pueblo Colorado. Rwy 17 + 25' bldgs 300' right of centerline 108' from rwy end. Rwy 17 has + 25' railroad 530' from thld centerline. Apron area is asph. Twy and rwy have no markings. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 719-438-5590

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAA.

LAMAR (VH) (DH) VORW/DME 116.9 LAA Chan 116 N38°11.83' W102°41.25' 329° 17.7 NM to fld. 3944/12E.

