

HAGERSTOWN RGNL/RICHARD A HENSON FLD (HGR)(KHGR) P (AR) 4 N UTC-5(-4DT)

WASHINGTON

N39°42.51' W77°43.59'

H-10H, 12I, L-29D, A

IAP, AD

703 B ARFF Index—See Remarks NOTAM FILE HGR

RWY 09-27: H7000X150 (ASPH-GRVD) S-100, D-150, 2S-175,
2D-250 PCR 750 F/A/X/T HIRL 0.3% up E

RWY 09: REIL PAPI(P4L)—GA 3.0° TCH 55'.

RWY 27: MALSR PAPI(P4L)—GA 3.0° TCH 55'.

RWY 02-20: H3165X100 (ASPH) S-80, D-100, 2S-127, 2D-170
PCR 600 F/A/X/T MIRL 0.3% up N

RWY 02: REIL PAPI(P2L)—GA 4.0° TCH 53'.

RWY 20: REIL PAPI(P2L)—GA 4.0° TCH 33'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 02: TORA-3165 TODA-3165 ASDA-3165 LDA-3165

RWY 09: TORA-7000 TODA-7000 ASDA-7000 LDA-7000

RWY 20: TORA-3165 TODA-3165 ASDA-3165 LDA-3165

RWY 27: TORA-7000 TODA-7000 ASDA-7000 LDA-7000

SERVICE: S4 FUEL 100LL, JET A OX 1, 2, 3, 4 LGT When ATCT clsd

ACTVT MALSR Rwy 27; REIL Rwy 09; HIRL Rwy

09-27—CTAF. **MILITARY—FUEL A, A+** (Avbl 1000-0300Z†,

C301-791-9119, OT 3 hr PN C301-730-4700/301-730-4100,

fee \$100/hr.) (NC-100LL) OIL O-128

AIRPORT REMARKS: Attended 1000-0300Z†. Airport unatnd

0300-1000Z†. Birds on and invof arpt. Ultralight act 12 NM east to 5000' MSL. Low level mil acft 10 NM north on

VR708 operating east to west. Fuel avbl 1000-0300Z†, call 301-791-9119. DOD contract fuel avbl. Rwy 02-20
CLOSED when ATCT clsd. Class I, ARFF Index B. ARFF Index C avbl upon req; ctc amgr. PPR 24 hrs for unskd acro prs
with more than 30 psg seats call pmgr 240-313-2764. Rwy 02-20 clsd to skd acro prs with more than 9 pax seats
and non skd acro prs with more than 30 pax seats excp for taxi. PPR 24 hr prior to aces the museum apn. For more info
ctc museum mgr at 240-520-3417. Twy P not avbl for air carrier ops. Ldg fee.

AIRPORT MANAGER: 240-313-2764**WEATHER DATA SOURCES:** ASOS 126.375 (301) 745-3497.**COMMUNICATIONS:** CTAF 120.3 UNICOM 122.95

® POTOMAC APP/DEP CON 126.825

TOWER 120.3 (1200-0300Z†) GND CON 120.8

CLEARANCE DELIVERY PHONE: For CD when ATCT is clsd ctc Potomac Apch at 866-709-4993.**AIRSPACE:** CLASS D svc 1200-0300Z†; other times CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE HGR.

(L) VORW 109.8 HGR N39°41.86' W77°51.34' 091° 6.0 NM to fld. 563/7W.

VOR unusable:

251°-280° byd 16 NM blo 4,000'

281°-300° byd 24 NM blo 8,000'

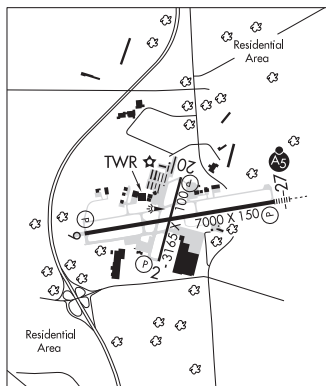
351°-050°

ST THOMAS (L) TACAN Chan 97 THS (115.0) N39°55.99' W77°57.06' 149° 17.0 NM to fld.

2338/7W. NOTAM FILE AOO.

ILS/DME 111.9 I-UYK Chan 56 Rwy 09. ILS unavbl when ATCT clsd.

ILS/DME 111.9 I-HGR Chan 56 Rwy 27. Class IE. OM/LOM OTS indef.

**HARFORD CO** (See CHURCHVILLE on page 95)**HAVRE DE GRACE SPB** (M06) 1 E UTC-5(-4DT) N39°32.49' W76°04.18'

WASHINGTON

00 NOTAM FILE DCA

WATERWAY E-W: 8000X200 (WATER)**WATERWAY E:** Bridge.**WATERWAY N-S:** 8000X200 (WATER)**WATERWAY S:** Bridge.**SEAPLANE REMARKS:** Attended May-Nov dawn-dusk. Birds on and invof arpt. +100 ft bridge aprxly 3500 ft north of N/S rwy.**AIRPORT MANAGER:** (410) 258-9648**COMMUNICATIONS:** CTAF/UNICOM 123.0**CLEARANCE DELIVERY PHONE:** For CD ctc Washington ARTCC at 703-771-3587.