

**RIDGELY****GOODEN AIRPARK** (RJD)(KRJD) 2 NE UTC-5(-4DT) N38°58.21' W75°51.98'**WASHINGTON**

64 B NOTAM FILE DCA

**L-34F, 36J, A****RWY 12-30:** H3214X50 (ASPH) S-28, D-39 LIRL**IAP****RWY 12:** REIL. P-line.**RWY 30:** REIL. Trees. Rgt t/c.**SERVICE:** S4 LGT Actvt aprt beacon—CTAF. Actvt REIL Rwy 12 & 30; LIRL Rwy 12-30—CTAF.**AIRPORT REMARKS:** Unattended. Birds, deer and wildlife on and invof aprt.

Unlimited vehicle access to acft movement areas. Turf areas adjacent to acft movement areas soft when wet. Twy/Apn pavements are failing with loose aggregate and alligator cracking. Rwy 12-30 thld bars and rwy numbers are half size. Rwy 12 and 30 mkg condition faded, crack seal thru mrkgs.

**AIRPORT MANAGER:** 302-270-2227**COMMUNICATIONS:** CTAF/UNICOM 122.8® **POTOMAC APP/DEP CON** 124.55**DOVER APP/DEP CON** 132.425 (Rwy 30)**CLEARANCE DELIVERY PHONE:** For CD ctc Dover Apch at 302-677-3940.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MIV.**SMYRNA (L) (L) VORTACW** 111.4 ENO Chan 51 N39°13.90'

W75°30.96' 235° 22.7 NM to fld. 15/9W.

TACAN AZIMUTH unusable:

140°-150° byd 36 NM blo 2,000'

200°-300° byd 36 NM blo 3,000'

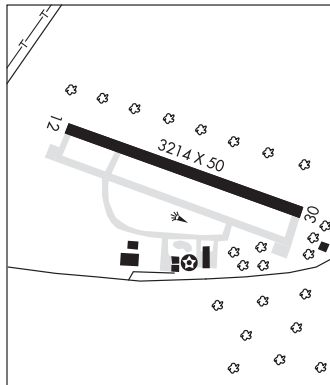
VOR unusable:

159°-169° blo 3,000 . 325-335 byd 15NM blo 4,900'

DME unusable:

140°-150° byd 36 NM blo 2,000'

200°-300° byd 36 NM blo 3,000'

**COMM/NAV/WEATHER REMARKS:** UNICOM unmon.**ST MARY'S CO RGNL** (See LEONARDTOWN on page 108)**SALISBURY****BENNETT** (1N5) 4 NW UTC-5(-4DT) N38°24.77' W75°37.02'**WASHINGTON**

46 B NOTAM FILE DCA

**RWY 17-35:** 3171X95 (TURF) LIRL**RWY 17:** APAP(PNIL)—GA 4.0° TCH 23'. Thld dsplcd 240'. Trees.**RWY 35:** APAP(PNIL)—GA 5.0°. Thld dsplcd 941'. Road.**RWY 08-26:** 2302X95 (TURF)**RWY 08:** Thld dsplcd 800'. Road.**RWY 26:** Thld dsplcd 300'. Trees.**SERVICE:** LGT Dusk-0400Z†. Actvt LIRL Rwy 17-35 and bcn—CTAF.

**AIRPORT REMARKS:** Attended dawn-dusk. Ultralight act on and invof aprt. Birds and wildlife on and invof aprt. +375 ft lgtd ant 3200 ft L of Rwy 35 thr on L downwind. Rwy 08 and Rwy 26 dthr mkd with 3 orange cones. Rwy 17 and Rwy 35 thr and dthr mkd with lgts and cones. Rwy 17-35 +60 ft trees mid-point both sides of rwy. +70' trees mid-point both sides rwy 17-35.

**AIRPORT MANAGER:** (443) 880-7428**COMMUNICATIONS:** CTAF/UNICOM 122.8® **PATUXENT APP/DEP CON** 127.95 (1200-0400Z† Mon-Sun. Other times by NOTAM) other times ctc® **POTOMAC APP/DEP CON** 127.2

**CLEARANCE DELIVERY PHONE:** For CD ctc Patuxent Apch at 301-342-3740, when Patuxent Apch is clsd ctc Potomac Apch at 866-640-4124.