

BARRE/MONTPELIER**EDWARD F KNAPP STATE** (MPV)(KMPV) 3 W UTC-5(-4DT) N44°12.21' W72°33.73'**MONTREAL**

1166 B NOTAM FILE MPV MON Airport

H-11D, 12K, L-32G**RWY 17-35:** H5000X100 (ASPH) S-31, D-70, 2S-88 MIRL**IAP**

1.5% up S

RWY 17: MALSR. PAPI(P4L)—GA 3.0° TCH 46'. Trees.**RWY 35:** REIL. Thld dsplcd 502'. Antenna.**RWY 05-23:** H3001X75 (ASPH) S-30, D-46 MIRL 1.0% up SW**SERVICE:** S4 **FUEL** 100LL, JET A+ **LGT** ACTVT MALSR Rwy 17; MIRL Rwy 17-35—CTAF.**AIRPORT REMARKS:** Attended 1300-2200Z†. Fld cond not mon when unatndd. Cold temperature airport. Altitude correction required at or below -19C.**AIRPORT MANAGER:** 802-279-9746**WEATHER DATA SOURCES:** ASOS 132.675 (802) 229-2037.**COMMUNICATIONS:** CTAF/UNICOM 122.8**MONTPELIER RCO** 122.2 (BURLINGTON RADIO)**MONTPELIER RCO** 122.6 (BURLINGTON RADIO)® **BOSTON CENTER APP/DEP CON** 135.7**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Boston ARTCC at 603-879-6859.**AIRSPACE:** CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MPV.**MONTPELIER (VL) (DH) VORW/DME** 116.9 MPV Chan 116 N44°05.13' W72°26.96' 342° 8.6 NM to fld.

2086/16W.

VOR unusable:

010°-020° byd 25 NM blo 7,500'

015°-031° byd 40 NM

032°-042° byd 40 NM blo 5,000'

032°-042° byd 65 NM

043°-060° byd 40 NM

043°-070° byd 40 NM blo 9,100'

045°-060° byd 24 NM blo 8,500'

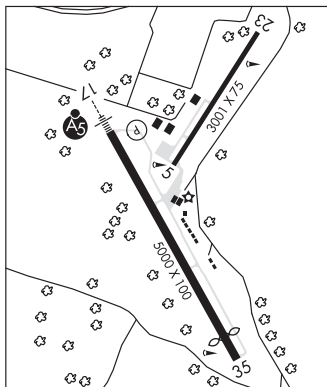
170°-182° byd 40 NM

210°-275° byd 40 NM

DME unusable:

043°-070° byd 40 NM

045°-060° byd 24 NM blo 8,500'

ILS/DME 108.7 I-MPV Chan 24 Rwy 17. Class IA. DME unmonitored. Localizer unusable byd 28° right of course.**COMM/NAV/WEATHER REMARKS:** UNICOM base station not manned continuously.**BASIN HARBOR** (See VERGENNES on page 333)