

WILLIAM M TUCK (See SOUTH BOSTON on page 377)

WILLIAMSBURG

WALTROP WILLIAMSBURG EXEC AIRPORT (JGG)(KJGG) 3 SW UTC-5(-4DT) N37°14.35'

WASHINGTON
L-34E, 36H
IAP

W76°42.97'

49 B TPA—849(800) NOTAM FILE JGG

RWY 13-31: H3204X60 (ASPH) S-12.5 MIRL 0.8% up NW

RWY 13: REIL. Tree. Rgt tfc.

RWY 31: REIL. Tree.

SERVICE: S4 **FUEL** 100LL, JET A+ **LGT** ACTVT REIL Rwy 13 and 31;
MIRL Rwy 13-31; perimeter lgts Rwy H1—CTAF.

NOISE: Noise abatement procedures in effect, ctc arpt manager
757-229-9256. Rwy 31 dep turn left heading 270° to avoid school
3500 ft off rwy end.

AIRPORT REMARKS: Attended Nov-Feb 1300-2300Z±, Mar-Oct
1300-0000Z±. Arpt unattended Christmas Day—attended by req. Deer
and birds on and in/ov arpt. PAEW adjacent to Rwy 13-31. Rwy 13-31
nmrs cracks in rwy pavement. PCI value of 45.

AIRPORT MANAGER: 757-229-9256

WEATHER DATA SOURCES: AWOS-3 120.625 (757) 220-8810.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **NORFOLK APP/DEP CON** 119.45

CLEARANCE DELIVERY PHONE: GCO avbl on freq 135.075 thru Norfolk CD, 4
clicks Norfolk, 5 leesburg radio (click slowly). If un, for CD ctc Norfolk
Apch at 757-464-0757.

RADIO AIDS TO NAVIGATION: NOTAM FILE DCA.

HARCUM (L) (L) VORTACW 108.8 HCM Chan 25 N37°26.92' W76°42.68' 188° 12.6 NM to fld. 8/7W.

VOR unusable:

056°-095° blo 2,000'


096°-112° byd 20 NM

174°

275°-300° blo 2,000'

• • • • •
HELIPAD H1: H60X60 (CONC)

HELIPORT REMARKS: Helipad CLOSED ctc 122.8 for ldg instructions. Helipad H1 perimeter lgts.

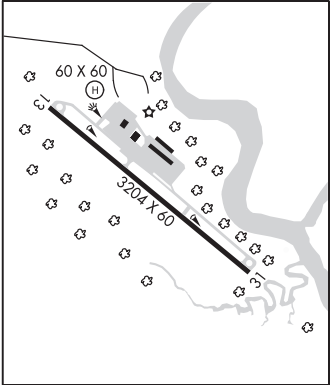

WINCHESTER RGNL (OKV)(KOKV) 3 SE UTC-5(-4DT) N39°08.61' W78°08.67'

WASHINGTON
H-10H, 12I, L-29D, A
IAP

726 B TPA—See Remarks NOTAM FILE OKV

RWY 14-32: H5498X100 (ASPH-GRVD) S-75, D-150 HIRL

0.5% up NW

RWY 14: REIL. PAPI(P4L)—GA 3.0° TCH 45'. Tree.

RWY 32: MALSR. PAPI(P4L)—GA 3.0° TCH 45'. Tree.

SERVICE: S4 **FUEL** 100LL, JET A **LGT** ACTVT MALSR Rwy 32; REIL
Rwy 14; HIRL Rwy 14-32—CTAF.

AIRPORT REMARKS: Attended 1100-0300Z±. Callout svc avbl, fees may
apply. Deer on and in/ov arpt. Taxi on pavement only. Med-Flight: irreg
dep pat. TPA 2706 (1980) turboprop and jet acft, all other acft TPA
1706 (980). Flight Notification Service (ADCUS) available. ADCUS
avbl 24 hours minimum advance notice required call 804-661-3660
Mon-Fri, after hours and weekends call 703-661-3632.

AIRPORT MANAGER: 540-662-5786

WEATHER DATA SOURCES: AWOS-3 124.85 (540) 662-6970.

COMMUNICATIONS: CTAF/UNICOM 122.975

Ⓡ **POTOMAC APP/DEP CON** 120.45

CLNC DEL 126.15

CLEARANCE DELIVERY PHONE: For CD ctc Potomac Apch at 866-709-4993.

RADIO AIDS TO NAVIGATION: NOTAM FILE MRB.

MARTINSBURG (L) (L) VORTACW 112.1 MRB Chan 58 N39°23.13'

W77°50.90' 231° 20.0 NM to fld. 600/7W.

VOR unusable:

020°-030° byd 15 NM blo 6,900'

127°-146° byd 15 NM

290°-310° byd 35 NM blo 5,400'

ILS/DME 109.55 I-TZX Chan 32(Y) Rwy 32. Class IA. LOC/DME unmonitored.

