

TEXHOMA MUNI (K49) 1 W UTC-6(-5DT) N36°30.34' W101°48.82'

WICHITA

3468 NOTAM FILE MLC

L-15B

RWY 03-21: H3564X48 (ASPH)

RWY 03: Thld dsplcd 590'. Road.

RWY 21: Thld dsplcd 340'. Fence.

RWY 17-35: 2340X75 (TURF)

RWY 17: Fence.

RWY 35: Road.

AIRPORT REMARKS: Unattended. Ultralight act on & invof arpt. Wind turbines 350 ft AGL lctd 2 mi south of arpt. Rwy 17-35 fairly smooth, few rodent mounds, several patches of cactus.

AIRPORT MANAGER: 806-753-6567

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.

RADIO AIDS TO NAVIGATION: NOTAM FILE DHT.


DALHART (L) (L) VORTACW 112.0 DHT Chan 57 N36°05.49'

W102°32.68' 043° 43.3 NM to fld. 4020/12E.

TAC AZM unusable:

240°-255° byd 15 NM

320°-350° byd 15 NM

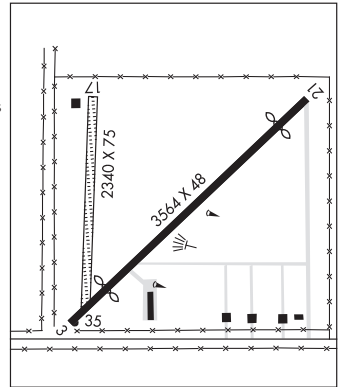

TEXOMA N33°56.65' W96°23.51' NOTAM FILE DUA.

DALLAS-FT. WORTH

(L) DME 114.3 URH Chan 90 at Durant Rgnl/Eaker Fld. 682.

H-6H, L-17D

DME unusable:

207°-240° byd 35 NM blo 2,500'

335°-350° byd 35 NM blo 2,500'

THOMAS MUNI (104) 1 SE UTC-6(-5DT) N35°44.02' W98°43.83'

DALLAS-FT. WORTH

1733 B NOTAM FILE MLC

L-15D

RWY 17-35: H3771X60 (ASPH) S-4 MIRL

IAP

RWY 17: PAPI(P2L)—GA 3.0° TCH 40'. Thld dsplcd 212'. Road.

RWY 35: PAPI(P2L)—GA 3.0° TCH 40'. Rgt tfc.

SERVICE: FUEL 100LL, JET A+ LGT Rwy 17 PAPI unusbl byd 8° right of cntrln. MIRL Rwy 17-35 on ss-sr preset low ints; incr/decr instst—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1400-2300Z†. Fuel 100LL, A+ avbl 24 hrs self svc with credit card. Svcs ctc amgr 580-603-2636.

AIRPORT MANAGER: 580-603-2636

COMMUNICATIONS: CTAF 122.9

® FORT WORTH CENTER APP/DEP CON 128.4

CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.

RADIO AIDS TO NAVIGATION: NOTAM FILE MLC.

KINGFISHER (H) TACAN Chan 94 IFI (114.7) N35°48.32'

W98°00.23' 254° 35.7 NM to fld. 1112/9E.

