

GOLDSBORO**WAYNE EXEC JETPORT** (GWW)(KGWW) 3 N UTC-5(-4DT) N35°27.63' W77°57.90'**CHARLOTTE**

134 B NOTAM FILE GWW

H-9C, 12H, L-35B, 36F**RWY 05-23:** H5501X100 (ASPH) S-51, D-71 PCN 19 F/C/X/T MIRL**IAP****RWY 05:** REIL. PAPI(P4L)—GA 3.0° TCH 40'. Trees.**RWY 23:** ODALS. REIL. PAPI(P4L)—GA 3.0° TCH 44'. Trees.**SERVICE:** S4 **FUEL** 100LL, JET A1+ **LGT** ACTVT REIL Rwy 05 and 23; ODALS Rwy 23; MIRL Rwy 05-23—CTAF. PAPIs Rwy 05 and 23 ops cons.**AIRPORT REMARKS:** Attended Mon-Sat 1300-2200Z†, Sun 1800-2200Z†. Unatndd federal hol. For emerg svc after hrs call 919-734-7630. Bird activity invof arpt. Ultralight; glider and parachute activity PPR call 919-734-7630. 24 hr self svc fuel avbl with credit card. Helicopter ops on twy leading to T-hangars. Helipad on twy with tfc cones and flags.**AIRPORT MANAGER:** 919-734-7630**WEATHER DATA SOURCES:** AWOS-3P 118.975 (919) 731-4473.**COMMUNICATIONS:** CTAF/UNICOM 122.975Ⓡ **SEYMOUR JOHNSON APP/DEP CON** 121.175 (1200-0400Z†)Ⓡ **WASHINGTON CENTER APP/DEP CON** 123.85 (0400-1200Z†)**CLEARANCE DELIVERY PHONE:** For CD ctc Seymour Johnson Apch at 919-722-4186. When Apch clsd, for CD ctc Washington ARTCC at 703-771-3587.**RADIO AIDS TO NAVIGATION:** NOTAM FILE ISO.**KINSTON (L) (L) VORTAC** 117.5 ISO Chan 122 N35°22.26' W77°33.50' 290° 20.7 NM to fld. 70/5W.

VOR unusable:

183°-215° byd 30 NM blo 5,000'

215°-238° blo 3,500'

215°-238° byd 6 NM

238°-258° byd 30 NM blo 5,000'

309°-319° byd 31 NM

348°-358° byd 20 NM

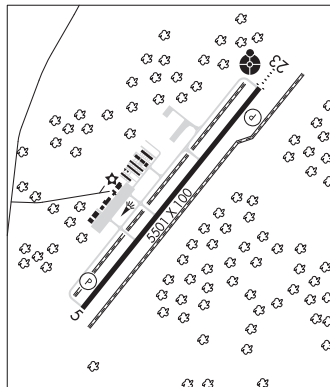
TAC AZM unusable:

183°-215° byd 30 NM blo 5,000'

TAC DME unusable:

183°-215° byd 30 NM blo 5,000'

ILS 111.9 I-UGZ Rwy 23. Class IB.

**GOOSE CREEK** (See INDIAN TRAIL on page 322)**GRAYS CREEK** (See FAYETTEVILLE on page 314)**GREENSBORO****AIR HARBOR** (W88) 6 N UTC-5(-4DT) N36°10.42' W79°48.18'**CINCINNATI**

822 NOTAM FILE RDU

RWY 09-27: H2460X65 (ASPH-TURF) MIRL(NSTD)**RWY 09:** Trees.**RWY 27:** Trees.**SERVICE:** S4 **FUEL** 100LL **LGT** Rwy 09-27 NSTD MIRL; edge lgts vary from 60'-75' from pavement S side; 8' fm pavement N side; night landings have no indication of pvmt location.**AIRPORT REMARKS:** Attended 1700Z†—dusk. After hrs emerg call 336-669-5462. Deer on and invof arpt. Fuel avbl 24hr credit card svc. Rwy 09 rwy nrs faded Rwy 09-27 marked with yellow cones indicating rwy width up to 100'. Rwy cond poor due to rwy wid. Rwy 09-27 north 25' width is asph. South 40' width is turf. Rwy 09 has +60' drop-off 220' fm thr. Rwy 27 has 8' drop-off 10' fm thr; left and right. Rwy 09 ldg uphill. Grvl access road 60' from Rwy 27 end. Aft hangar access immediately adjacent to rwy, parked planes left side of Rwy 27.**AIRPORT MANAGER:** 336-669-5462**COMMUNICATIONS:** CTAF/UNICOM 122.8**CLEARANCE DELIVERY PHONE:** For CD ctc Greensboro Apch at 743-222-6129.