

ANDREWS**ROBERT F SWINNIE** (PHH)(KPHH) 2 E UTC-5(-4DT) N33°27.10' W79°31.57'**CHARLOTTE**

26 B NOTAM FILE AND

L-24I

RWY 18-36: H3001X60 (ASPH) S-11, D-22 MIRL 0.3% up S

IAP

RWY 18: PAPI(P2L)—GA 3.0° TCH 38'. Tree.**RWY 36:** PAPI(P2L)—GA 3.0° TCH 34'.**AIRPORT REMARKS:** Unattended.**AIRPORT MANAGER:** 843-545-3638**COMMUNICATIONS:** CTAF 122.9Ⓡ **MYRTLE BEACH APP/DEP CON** 127.4 (1100-0400Z‡)Ⓡ **JACKSONVILLE CENTER APP/DEP CON** 134.375 (0400-1100Z‡)**CLEARANCE DELIVERY PHONE:** For CD ctc Myrtle Beach Apch at

843-477-2727 or 843-477-2704, when Apch clsd ctc Jacksonville

ARTCC at 904-845-1592.

RADIO AIDS TO NAVIGATION: NOTAM FILE CHS.**CHARLESTON (VH) (H) VORTAC** 113.5 CHS Chan 82 N32°53.66'

W80°02.27' O43° 42.2 NM to fld. 39/5W.

VOR unusable:

070°-106° byd 40 NM

106°-116°

116°-146° byd 40 NM

248°-272° byd 40 NM blo 8,000'

TACAN AZIMUTH unusable:


109°-120° byd 25 NM

137°-147°

160°-170°

229°-262° byd 12 NM blo 5,000'

262°-272° byd 15 NM blo 5,000'

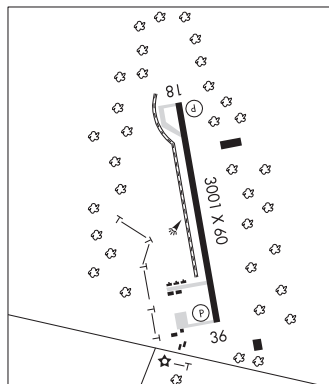**ASHLY** N32°58.58' W80°05.85' NOTAM FILE CHS.**CHARLOTTE****NDB (HW/LOM)** 329 CH 155° 5.5 NM to Charleston AFB/Intl. 36/7W.

H-9C, 12G, L-23A, 24I

BAMBERG CO (99N) 5 W UTC-5(-4DT) N33°18.27' W81°06.51'**CHARLOTTE**

231 B NOTAM FILE AND

L-24I

RWY 05-23: H3603X60 (ASPH) S-30, D-60 MIRL 0.6% up NE


IAP

RWY 05: PAPI(P2L)—GA 3.0° TCH 40'. Tree.**RWY 23:** PAPI(P2L)—GA 3.0° TCH 41'. Tree.**SERVICE:** FUEL 100LL LGT Actvt PAPI Rwy 05 & 23; MIRL Rwy

05-23—CTAF.

AIRPORT REMARKS: Unattended.**AIRPORT MANAGER:** 803-245-5191**COMMUNICATIONS:** CTAF/UNICOM 122.8Ⓡ **COLUMBIA APP/DEP CON** 124.15**CLEARANCE DELIVERY PHONE:** For CD ctc Columbia Apch at 803-822-5242 or

803-822-5040.

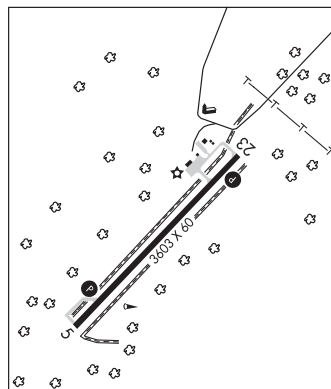

CONTINUED ON NEXT PAGE

SOUTH CAROLINA

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE AND.

ALLEDALE (VL) VOR 116.7 ALD N33°00.75' W81°17.53' 029° 19.8 NM to fld. 187/1W.

VOR unusable:

019°-029° byd 40 NM blo 3,000'
 019°-029° byd 52 NM
 030°-084° byd 16 NM blo 6,000'
 030°-084° byd 26 NM
 085°-109° byd 40 NM
 110°-120° byd 40 NM blo 6,000'
 110°-120° byd 48 NM
 110°-200° blo 3,000'
 110°-200° byd 16 NM blo 6,000'
 121°-187° byd 40 NM
 198°-200° byd 40 NM
 260°-269° byd 40 NM
 270°-286° byd 40 NM blo 3,000'
 270°-286° byd 59 NM
 300°-302° byd 40 NM
 315°-319° byd 40 NM
 320°-330° byd 40 NM blo 4,000'
 320°-330° byd 46 NM
 325°-002° byd 31 NM blo 2,400'
 331°-335° byd 40 NM
 340°-005° byd 40 NM

BARNWELL RGNL (BNL)(KBNL) 1 NW UTC-5(-4DT) N33°15.46' W81°23.29'

246 B NOTAM FILE AND

RWY 17-35: H5119X100 (ASPH) S-69, D-99 PCN 26 F/B/X/T MIRL

RWY 17: ODALS. PAPI(P2L)—GA 3.04° TCH 55'. Tree. Rgt tfc.

RWY 35: PAPI(P2L)—GA 3.0° TCH 45'. Tree.

RWY 05-23: H4526X70 (ASPH-AFSC) S-12

RWY 23: Rgt tfc.

SERVICE: FUEL 100LL, JET A, MOGAS LGT ACTVT ODALS Rwy 17;
 MIRL Rwy 17-35—CTAF. PAPI Rwy 17 and Rwy 35 oper consly, otr
 times—CTAF.

AIRPORT REMARKS: Attended 1400-2200Z†. 100LL fuel 24 hr credit card
 svc avbl. Emerg fuel shutoff lctd on right side of trml bldg atchd to elec
 vault. Rwy 05-23 has multiple cracks and raveling producing FOD.
 Rwy thrs not mkd. Rwy 05-23 rstd use to acft weighing 12,500 lbs
 and less. Aerobatic act west of Rwy 17-35. When active, incoming
 acft apch arpt from east.

AIRPORT MANAGER: 803-259-1090

WEATHER DATA SOURCES: AWOS-3PT 119.775 (803) 259-4536.

COMMUNICATIONS: CTAF/UNICOM 122.8

® **JACKSONVILLE CENTER APP/DEP CON** 132.925

GCO 121.725 (ZJX CLEARANCE DELIVERY)

CLEARANCE DELIVERY PHONE: For CD if una via GCO ctc Jacksonville ARTCC
 at 904-845-1592.

RADIO AIDS TO NAVIGATION: NOTAM FILE CAE.

COLUMBIA (VH) (H) VORTAC 114.7 CAE Chan 94 N33°51.44' W81°03.23' 207° 39.6 NM to fld. 404/2W.

VOR unusable:

000°-073° byd 35 NM blo 6,000'
 200°-234° byd 12 NM blo 3,000'
 235°-245° byd 12 NM blo 6,000'
 246°-289° byd 12 NM blo 3,000'
 290°-305° byd 12 NM blo 2,400'
 306°-344° byd 30 NM
 345°-359° byd 10 NM blo 5,000'

CHARLOTTE

H-9B, 12G, L-241

IAP

