

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS D svc 1500-0500Z†; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE RAL.

PARADISE (VH) (H) VORTACW 112.2 PDZ Chan 59 N33°55.10' W117°31.80' 039° 18.1 NM to fld. 1432/15E.

TACAN AZIMUTH unusable:

130°-145° byd 25 NM blo 5,000'
145°-190° blo 8,000'
190°-230° blo 10,000'
310°-325° byd 35 NM blo 10,900'
325°-345° byd 25 NM blo 11,500'
345°-360° byd 35 NM blo 10,500'

VOR unusable:

000°-006° byd 40 NM
007°-017° byd 40 NM blo 10,000'
007°-017° byd 48 NM
010°-015° byd 20 NM blo 10,000'
018°-024° byd 40 NM
025°-035° blo 10,700'
025°-035° byd 44 NM
036°-040° byd 40 NM
041°-051° byd 40 NM blo 25,000'
052°-065° byd 40 NM
080°-088° byd 40 NM
108°-118° byd 40 NM blo 9,000'
108°-118° byd 53 NM
119°-144° byd 40 NM blo 12,000'
119°-144° byd 85 NM
130°-145° byd 25 NM blo 5,000'
145°-190° blo 8,000'
145°-190° byd 25 NM blo 10,000'
145°-190° byd 39 NM blo 13,500'

DME unusable:

130°-145° byd 25 NM blo 5,000'
145°-190° blo 8,000'
190°-230° blo 10,000'
310°-325° byd 35 NM blo 10,900'
325°-345° byd 25 NM blo 11,500'
345°-360° byd 35 NM blo 10,500'

VOR unusable:

190°-230° byd 28 NM blo 15,000'
190°-230° byd 40 NM
285°-300° byd 40 NM
301°-311° byd 40 NM blo 18,000'
310°-325° byd 35 NM blo 10,900'
325°-345° byd 25 NM blo 11,500'
345°-360° byd 35 NM blo 10,500'

PETIS NDB (HW) 397 SB N34°03.39' W117°21.97' 056° 6.9 NM to fld. 972/14E. NOTAM FILE ONT.

ILS 109.3 I-SBD Rwy 06. Class IE. LOM PETIS NDB. Unmonitored 0500-1500Z†.

COMM/NAV/WEATHER REMARKS: Redlands Arpt (REI) 4.5 NM east TPA 2500 MSL CTAF/AUNICOM 123.05.

SAN CARLOS (SQL)(KSQL) 2 NE UTC-8(-7DT) N37°30.71' W122°14.97'

SAN FRANCISCO

6 B TPA—See Remarks NOTAM FILE SQL

L-2F, 3B, A

RWY 12-30: H2621X75 (ASPH) S-12.5 MIRL

IAP, AD

RWY 12: REIL. VASI(V2L)—GA 3.0° TCH 25'. Pole.


RWY 30: REIL. VASI(V2L)—GA 3.0° TCH 25'. Rgt tfc.

SERVICE: S2 FUEL 100LL, JET A, A+, UL94 OX 2 LGT When ATCT clsd; actvrt MIRL Rwy 12-30 and REIL Rwy 12-30—119.0. Rwy 30 VGSI unusbl byd 8 deg left of cntrln.

NOISE: Noise sensitive areas south through northeast of arpt. For noise abatement procedures ctc arpt manager 650-573-3700. See Special Notices—San Carlos Noise Abatement VFR to IFR Departure.

AIRPORT REMARKS: Attended 1500-0500Z†. Migratory bird activity on and in/ovf arpt. 100' steel transmission twrs and powerlines located 750' west and parallel to Rwy 12-30. 7' lighted dike located in rwy safety area on AER 30. Calm wind Rwy 12. No touch and go lds, or stop and go lds, when twr clsd. TPA—806(800). TPA applies to both fixed-wing and hel. Fixed-wing right tfc Rwy 30/left tfc Rwy 12. Hel right tfc Rwy 12/left tfc Rwy 30. Large helicopter should avoid overflight of dirt infield areas.

AIRPORT MANAGER: 650-573-3700

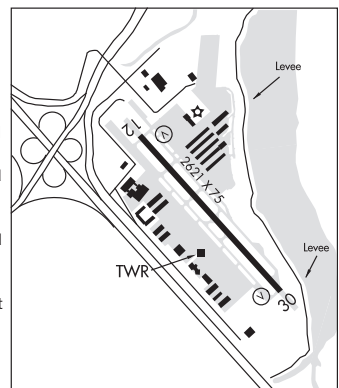

CONTINUED ON NEXT PAGE

