

KETCHIKAN INTL (KTN)(PAKT) 1 W UTC-9(-8DT) N55°21.25' W131°42.67'

KETCHIKAN
H-10, L-1C
IAP, AD

92 B LRA ARFF Index—See Remarks NOTAM FILE KTN

RWY 11-29: H7500X150 (ASPH-GRVD) S-120, D-207, 2D-350

PCR 510 F/B/X/T HIRL

RWY 11: MALSR. PAPI(P4L)—GA 3.0° TCH 50'. RVR-TR Trees. Rgt tfc.

RWY 29: MALSR. PAPI(P4L)—GA 3.0° TCH 49'. RVR-TR

SERVICE: **FUEL** 100LL, **JET A** **LGT** When KTN FSS clsd ACTVT MALSR
Rwy 11 and 29; HIRL Rwy 11-29—CTAF. PAPI Rwy 11 and 29 opr
consly. Rwy 11 PAPI unusbl byd 5 deg left and right of cntrln. Rwy 29
PAPI unusbl byd 6 NM. Arpt bcn: when KTN FSS clsd opr consly. Twy
C lghts OTS indef.

AIRPORT REMARKS: Alert: Spl ATC rules part 93, and std VFR arr and dep
proc and pat info—see Reg Notice. Attended 1500-0630Z†. 100LL fuel
1530-0530Z† - 122.95 or 907-531-9891. PPR for ldg durg
unatndd hrs—FBO 907-531-9891 for arrngmt and call out charge.
Class I, ARFF Index B. Acr ops more than 30 pax NA in excess of 15
min bfr or aft sked arr or dep wo PPR with AMGR and cfrn ARFF svc
avbl bfr ldg or tkof. USCG heli lctd at N55°-21'-27.6"

W131°-42'-19.8" invof Ketchikan Intl arpt and Seaplane Base;
MED-VAC missions only—POC Commander CG District 17, 709 W 9th
St, RM 661. Box 25517 Juneau, AK 99802, 907-463-2247/2000.

Trrn causes turb on arr and dep routes. Snow and ice removal NA when
arpt unatndd. Sfc cond reports reflect conditions while arpt attended only. Ctn air taxi and boat tfc in harbor; floating debris
psbl. Dock W of arpt clsd Nov 1-Apr 1; PPR ovngt-AMGR; Ferry btw arpt and city opr consly when arpt atndd. Birds on
and invof arpt. Deer invof arpt. Prior to ops on apron/twy all acft ctc KTN FSS and adz intns. Rwy 11-29 sand used to
enhance friction may not meet FAA specs. GA apron; Twy C; NE section of main apron PCN 21/F/B/X/T. Lndg fee for GA
acft under 6000 lb and float plane use of spb float. Rwy 11 Rtg tfc: Wx pmtg for light single/twim eng.

AIRPORT MANAGER: 907-225-6800

WEATHER DATA SOURCES: ASOS 134.45 (907) 247-8801. (WX CAM)

COMMUNICATIONS: CTAF 123.6 AFIS 134.45 (1515-0615Z†; OT ctc Juneau FSS)

FSS (KETCHIKAN RCO) 1515-0615Z†; OT ctc Juneau FSS.

KETCHIKAN RADIO 121.5 122.2 123.6 243.0 (LAA 123.6)

ANCHORAGE CENTER APP/DEP CON 118.5 284.6

AIRSPACE: CLASS E svc continuous.

RADIO AIDS TO NAVIGATION: NOTAM FILE KTN.

CLAM COVE NDB (HW) 396 CMJ N55°20.53' W131°41.45' 295° 1.0 NM to fld. 46/21E.

NDB unusable:


Byd 15 NM

ILS/DME 109.3 I-ECH Chan 30 Rwy 11. Class IT. DME unusable byd 25° left of course, byd 15° right of course.

LOC unusable beyond 15° right of rcl. LOC unusable beyond 25° left of rcl.

COMM/NAV/WEATHER REMARKS: For a LC to Ketchikan FSS dial 225-9481. For a LC to Juneau FSS dial 789-7380. AFIS operd
by KTN FSS when open, OT Juneau FSS.

• • • • •
WATERWAY WNW-ESE: 9500X1500 (WATER)

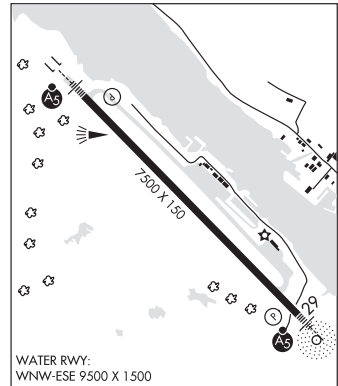

MURPHYS PULLOUT SPB (8K9) 5 NW UTC-9(-8DT) N55°23.38' W131°44.28'

KETCHIKAN

00 NOTAM FILE KTN

WATERWAY NE-SW: 10000X2000 (WATER)

SEAPLANE REMARKS: Unattended. No public float plane parking avbl. Auto dial phone for FSS ATIS Hospital USCG and spill
response avbl.

AIRPORT MANAGER: 907-225-6800

COMMUNICATIONS: CTAF 123.6

COMM/NAV/WEATHER REMARKS: LC to Ketchikan FSS dial 225-9481. For a LC to Juneau FSS dial 789-7380.