

SANDUSKY CITY (Y83) 3 N UTC-5(-4DT) N43°27.34' W82°50.51'

777 B NOTAM FILE LAN

RWY 10-28: H3499X75 (ASPH) S-16 MIRL

RWY 10: REIL. PAPI(P2L)—GA 3.0° TCH 41'.

RWY 28: PAPI(P2L)—GA 3.0° TCH 39'.

RWY 18-36: 2271X153 (TURF)

RWY 36: Thld dsplcd 374'. Road.

SERVICE: S4 FUEL 100LL LGT ACTVT MIRL Rwy 10-28—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1400-2130Z†, Sat-Sun on call. For svc aft hrs call AMGR. Deer and lrg birds on and invof arpt. For aft hrs aces to trml bldg call AMGR. +3 ft embankment, 50 ft fm Rwy 36 thr, -10 ft ditch, 100 ft east of Rwy 18-36. Rwy 18 and Rwy 36 marked with 3 ft yellow cones.

AIRPORT MANAGER: 810-414-3009


COMMUNICATIONS: CTAF/UNICOM 122.8

® CLEVELAND CENTER APP/DEP CON 127.7

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland ARTCC at 440-774-0224/0490.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAN.

PECK (H) TACAN Chan 87 ECK (114.0) N43°15.35' W82°43.08' 343° 13.2 NM to fld. 810/7W.

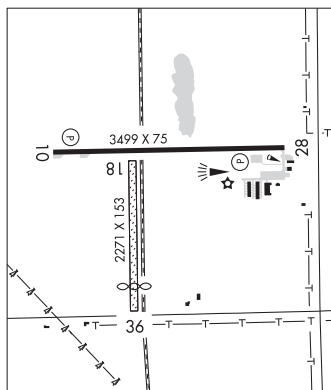

DETROIT
L-28J, 31C
IAP

SAULT STE MARIE

CHIPPEWA CO INTL (CIU)(KCIU) 15 S UTC-5(-4DT) N46°15.05' W84°28.34'

799 B TPA-1599(800) LRA ARFF Index—See Remarks NOTAM FILE CIU

RWY 16-34: H7203X150 (ASPH-CONC-GRVD) S-120, D-215,

2S-175, 2D-369, 2D/2D2-855 PCR 680 R/B/W/T HIRL

RWY 16: MALSR. PAPI(P4L)—GA 3.0° TCH 57'. Rgt tfc.

RWY 34: REIL. PAPI(P4L)—GA 3.0° TCH 41'.

RWY 10-28: H5001X75 (ASPH-GRVD) S-55, D-88, 2D-155

PCR 200 F/B/X/T MIRL

RWY 10: REIL. PAPI(P4L)—GA 3.0° TCH 40'. Trees.

RWY 28: REIL. PAPI(P4L)—GA 3.0° TCH 40'. Trees.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 10: TORA-5000 TODA-5000 ASDA-5000 LDA-5000

RWY 16: TORA-7203 TODA-7203 ASDA-7203 LDA-7203

RWY 28: TORA-5000 TODA-5000 ASDA-5000 LDA-5000

RWY 34: TORA-7203 TODA-7203 ASDA-7203 LDA-7203

SERVICE: FUEL 100LL, JET A LGT Actvt MALSR Rwy 16; REIL Rwy 34, 10, & 28; PAPI Rwy 16, 34, 10, & 28; HIRL Rwy 16-34; MIRL Rwy 10-28—CTAF. REIL & PAPI Rwy 34 opr consly Dec-Mar; PAPI Rwy 10 & 28 opr consly drg dalgt hrs. Rwy end 28: PAPI unusbl byd 8 degs left of ccntrl.

AIRPORT REMARKS: Attended 1100-2300Z†. Birds on and invof arpt.

Ficons unmon 0200-1200Z†. 24 hr PPR for unskd acr ops gtr than 9 pax seats - call amgr. Class I, ARFF Index A. ARFF coverage provided scheduled FAR 121 acft only, other times by prior arrangement with airport manager. Rwy 16-34 cntr 150 ft is asph, rmng outside edges are conc. Exp snow removal act dly Dec-Mar. Vehicle testing inpr drg winter months on sections of clsd/abndd partl twy, SE of apch end Rwy 34. Area may be plowed to bare sfc but unavbl for arr or dep. Flight Notification Service (ADCUS) available.

AIRPORT MANAGER: 906-495-5631

WEATHER DATA SOURCES: AWOS-3PT 127.575 (906) 495-1156.


COMMUNICATIONS: CTAF/UNICOM 123.0

CHIPPEWA RCO 122.6 (GREEN BAY RADIO)

SAULT STE MARIE RCO 122.1R 112.2T (GREEN BAY RADIO)

TORONTO CENTER APP/DEP CON 132.65

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Minneapolis ARTCC at 651-463-5588.

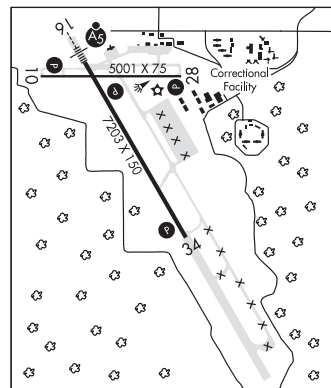

LAKE HURON
H-2L, L-31B
IAP, AD

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE CIU.

SAULT STE MARIE (VH) (DH) VOR/DME 112.2 SSM Chan 59 N46°24.73' W84°18.89' 218° 11.7 NM to fld.
687/4W.

VOR unusable:

007°-034° byd 40 NM
052°-095° byd 40 NM
085°-105° byd 10 NM blo 5,000'
085°-105° byd 20 NM blo 8,000'
124°-134° byd 40 NM
157°-167° byd 40 NM blo 2,900'
157°-167° byd 46 NM
207°-216° byd 40 NM
329°-344° byd 40 NM
354°-004° byd 40 NM

KOLOE NDB (MHW/LOM) 400 CI N46°19.95' W84°32.55' 156° 5.7 NM to fld. 644/7W. NDB unmonitored.

ILS 110.3 I-CIU Rwy 16. Class IA. LOM KOLOE NDB. Unmonitored. Glideslope unusable blw 1,090'. LOC unusable w/ 0.6 NM. Autopilot cpd apch NA blw 1,380'. LOM unmonitored.

SAULT STE MARIE MUNI/SANDERSON FLD (ANJ)(KANJ) 1 SW UTC-5(-4DT) N46°28.75'

LAKE HURON

H-2L, 11A, L-31B

IAP

W84°22.10'

716 AOE NOTAM FILE ANJ MON Airport

RWY 14-32: H5234X100 (ASPH-TRTD-PFC) MIRL 0.4% up SE

RWY 14: REIL. PAPI(P2L)—GA 3.0° TCH 46'. Thld dsplcd 180'.

RWY 32: REIL. PAPI(P2L)—GA 3.0° TCH 30'. Thld dsplcd 178'. Road.

Rgt tfc.

SERVICE: S4 FUEL 100LL, JET A+ LGT ACTVT REIL Rwys 14 and

Rwy 32; PAPI Rwys 14 and Rwy 32; MIRL Rwy 14-32—CTAF

AIRPORT REMARKS: Attended 1300-2200Z†. Deer, birds, and wildlife on

and invof arpt. 100LL avbl H24 self svc via credit card. 50' drop off,

N end, 200' fm rwy end. US Customs avbl on req call

906-632-2631 1 hr prior to arr.

AIRPORT MANAGER: 906-635-0252

WEATHER DATA SOURCES: ASOS 118.375 (906) 442-4144.

COMMUNICATIONS: CTAF/UNICOM 122.7

RCO 122.1R 112.2T (GREEN BAY RADIO)

® TORONTO CENTER APP/DEP CON 132.65

CLEARANCE DELIVERY PHONE: For CD etc Minneapolis ARTCC at

651-463-5588.

RADIO AIDS TO NAVIGATION: NOTAM FILE CIU.


(VH) (DH) VOR/DME 112.2 SSM Chan 59 N46°24.73'

W84°18.89' 335° 4.6 NM to fld. 687/4W.

VOR unusable:

007°-034° byd 40 NM
052°-095° byd 40 NM
085°-105° byd 10 NM blo 5,000'
085°-105° byd 20 NM blo 8,000'
124°-134° byd 40 NM
157°-167° byd 40 NM blo 2,900'
157°-167° byd 46 NM
207°-216° byd 40 NM
329°-344° byd 40 NM
354°-004° byd 40 NM

COMM/NAV/WEATHER REMARKS: Pilots oprg in Canadian/US Class D asp are rqrd to estab and mntn two-way com and obtain ATC clearance from Sault Ste Marie ATCT (SOO TOWER 118.8) prior to oprg in the Class D asp. Tfc adzy ser(118.8) is avbl in the US Class E sfc extn 1130-0330Z†.

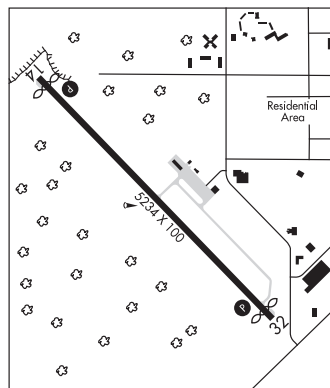

SAULT STE MARIE MUNI/SANDERSON FLD (See SAULT STE MARIE on page 245)