

CUSHING FLD LTD (See NEWARK on page 75)

DACY (See HARVARD on page 63)

DANVILLE

VERMILION RGNL (DNV)(KDNV) 4 NE UTC-6(-5DT) N40°11.99' W87°35.71'

697 B NOTAM FILE DNV

RWY 03-21: H6006X100 (ASPH-PFC) S-50, D-75, 2S-95 HIRL

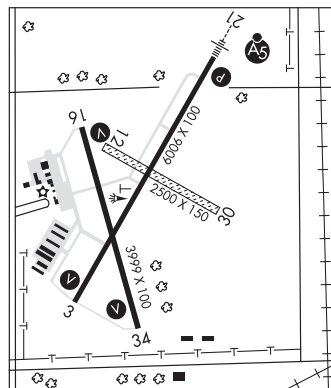
0.8% up NE

RWY 03: VASI(V4L)—GA 3.0° TCH 41'. Tree.**RWY 21:** MALSR. PAPI(P4L)—GA 3.0° TCH 46'.**RWY 16-34:** H3999X100 (ASPH-GRVD) S-40, D-50 MIRL

0.6% up N

RWY 16: VASI(V2L)—GA 3.0° TCH 23'.**RWY 34:** VASI(V2L)—GA 3.0° TCH 14'.**RWY 12-30:** 2500X150 (TURF) 0.3% up NW**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** HIRL Rwy 03-21 preset low intst
—to incr intst & ACTVT MALSR Rwy 21; VASI Rwy 03, 16 & 34; PAPI
Rwy 21; MIRL Rwy 16-34—CTAF.**AIRPORT REMARKS:** Attended 1300-0400Z†. Extv glider ops weekends. Rwy
12-30 seasonal rwy Nov 1-May 1; Ctc amgr 217-442-4624. Air
cargo Part 135 flt depts ngly 0400Z†, arrs dly 1200Z† Mon-Sat.**AIRPORT MANAGER:** 217-442-4624**WEATHER DATA SOURCES:** AWOS-3 119.275 (217) 442-4660.**COMMUNICATIONS:** CTAF/UNICOM 122.7Ⓡ **CHAMPAIGN APP/DEP CON** 121.35 (1200-0500Z† other times ctc)Ⓡ **CHICAGO CENTER APP/DEP CON** 121.35

CLNC DEL 121.7

CLEARANCE DELIVERY PHONE: For CD if unable via radio ctc Champaign Apch at 217-355-4071, when Apch clsd ctc Chicago
ARTCC at 630-906-8921**RADIO AIDS TO NAVIGATION:** NOTAM FILE DNV.**DANVILLE (L) TACAN** Chan 47 DNV (111.0) N40°17.63' W87°33.44' 195° 5.9 NM to fld. 699/2E.**JULIP NDB (LOMW)** 332 DN N40°17.38' W87°31.80' 209° 6.2 NM to fld. 706/0E.**ILS 108.5 I-DNV** Rwy 21. Class IE. LOM JULIP NDB. Unmonitored.

CHICAGO

H-5E, L-27D

IAP

DANVILLE N40°17.63' W87°33.44' NOTAM FILE DNV.

(L) TACAN 111.0 DNV Chan 47 195° 5.9 NM to Vermilion Rgnl. 699/2E.

CHICAGO

H-5E, 4H, L-27D

DE KALB TAYLOR MUNI (DKB)(KDKB) 2 E UTC-6(-5DT) N41°56.03' W88°42.34'

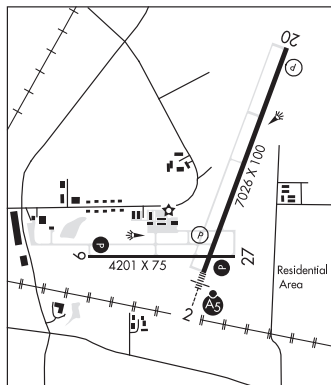
913 B NOTAM FILE DKB

RWY 02-20: H7026X100 (ASPH-GRVD) S-25, D-80 MIRL**RWY 02:** MALSR. PAPI(P4L)—GA 3.0° TCH 53'. Railroad.**RWY 20:** REIL. PAPI(P4L)—GA 3.0° TCH 29'.**RWY 09-27:** H4201X75 (ASPH-GRVD) S-25, D-80 MIRL**RWY 09:** REIL. PAPI(P4L)—GA 3.0° TCH 30'.**RWY 27:** REIL. PAPI(P4L)—GA 3.0° TCH 24'. Tree.**SERVICE:** S4 **FUEL** 100LL, JET A1+ **OX 4** **LGT** MIRL Rwy 02-20
preset low intst, to incr intst and actvt MIRL Rwy 09-27, PAPI Rwy
09 and Rwy 27, REIL Rwy 09, 27 and 20; MALSR Rwy 02—CTAF.
PAPI Rwy 02 and Rwy 20 operate 24 hrs.**AIRPORT REMARKS:** Attended Nov-Feb 1400-2200Z†, Mar-Oct
1400-2300+-. Fuel: 100LL 24 hr self serve with credit card.
Prfered calm wind Rwy 02.**AIRPORT MANAGER:** 815-748-8102**WEATHER DATA SOURCES:** AWOS-3 119.075 (815) 748-2350.**COMMUNICATIONS:** CTAF/UNICOM 122.7Ⓡ **CHICAGO APP/DEP CON** 133.5**CLEARANCE DELIVERY PHONE:** For CD ctc Chicago Apch at 847-289-0926.**RADIO AIDS TO NAVIGATION:** NOTAM FILE DPA.**DUPAGE (VL) (L) VORW/DME** 114.55 DPA Chan 92(Y) N41°53.42'

W88°21.01' 277° 16.1 NM to fld. 802/2E.

VOR unusable:

042°-047° byd 40 NM

ILS/DME 109.95 I-DJK Chan 36(Y) Rwy 02. Class IT. Unmonitored.

CHICAGO

H-5E, L-28H

IAP