

GORDONSVILLE MUNI (GVE)(KGVE) 2 NE UTC-5(-4DT) N38°09.36' W78°09.95'

452 B NOTAM FILE DCA

RWY 05-23: H2300X50 (ASPH) S-12.5 MIRL**RWY 05:** APAP(PNIR). Tree.**RWY 23:** APAP(PNIR). Tree.**SERVICE:** LGT ACTVT MIRL Rwy 05-23—CTAF.**AIRPORT REMARKS:** Unattended. After hrs ctc 907-545-4555.**AIRPORT MANAGER:** (540) 832-2233**WEATHER DATA SOURCES:** AWOS-3 120.225 (540) 832-2095.**COMMUNICATIONS:** CTAF/UNICOM 123.0**RCO 122.1R 115.6T** (LEESBURG RADIO)® **POTOMAC APP/DEP CON** 132.85**CLEARANCE DELIVERY PHONE:** For CD ctc Potomac Apch at 866-640-4124.**RADIO AIDS TO NAVIGATION:** NOTAM FILE DCA.**(VH) (H) VORTAC** 115.6 GVE Chan 103 N38°00.82'

W78°09.18' 002° 8.6 NM to fld. 383/6W.

TACAN AZIMUTH unusable:

250°-260° byd 25 NM blo 7,000'

VOR unusable:

005°-050° byd 40 NM

180°-207° byd 40 NM

208°-218° byd 40 NM blo 3,000'

208°-218° byd 50 NM

219°-225° byd 40 NM

260°-301° byd 40 NM

302°-312° byd 40 NM blo 9,000'


302°-312° byd 65 NM

313°-331° byd 40 NM

332°-342° byd 40 NM blo 6,100'

332°-342° byd 46 NM

343°-360° byd 40 NM

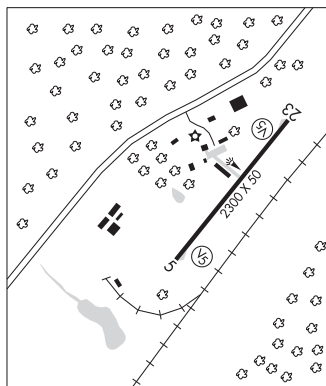

WASHINGTON

L-34E, 36H

IAP

GORDONSVILLE N38°00.82' W78°09.18' NOTAM FILE DCA.**(VH) (H) VORTAC** 115.6 GVE Chan 103 002° 8.6 NM to Gordonsville Muni. 383/6W.

WASHINGTON

H-10H, 12H, L-34E, 36H

TACAN AZIMUTH unusable:

250°-260° byd 25 NM blo 7,000'

VOR unusable:

005°-050° byd 40 NM

180°-207° byd 40 NM

208°-218° byd 40 NM blo 3,000'

208°-218° byd 50 NM

219°-225° byd 40 NM

260°-301° byd 40 NM

302°-312° byd 40 NM blo 9,000'

302°-312° byd 65 NM

313°-331° byd 40 NM

332°-342° byd 40 NM blo 6,100'

332°-342° byd 46 NM

343°-360° byd 40 NM

RCO 122.1R 115.6T (LEESBURG RADIO)**HAMPTON ROADS EXEC** (See NORFOLK on page 368)**HANOVER CO MUNI** (See RICHMOND/ASHLAND on page 376)**HARCUM** N37°26.92' W76°42.68' NOTAM FILE DCA.**(L) (L) VORTACW** 108.8 HCM Chan 25 338° 5.0 NM to Middle Peninsula Rgnl. 8/7W.

WASHINGTON

H-10H, 12H, L-34E, 36H

VOR unusable:

056°-095° blo 2,000'

096°-112° byd 20 NM

174°

275°-300° blo 2,000'