

FIRST AIR FLD (See MONROE on page 248)

FISHERMANS BAY SPB (See LOPEZ on page 244)

FLOATHAVEN SPB (See BELLINGHAM on page 223)

FLY FOR FUN (See VANCOUVER on page 281)

FORKS (S18) 1 SW UTC-8(-7DT) N47°56.26' W124°23.76'

SEATTLE

299 NOTAM FILE SEA

RWY 04-22: H2400X75 (ASPH) MIRL

RWY 04: Trees.

RWY 22: Tree, Rgt tfc.

AIRPORT REMARKS: Unattended. Wildlife on and invof arpt. Parallel twy marked with reflectors.

AIRPORT MANAGER: 360-374-5412

COMMUNICATIONS: CTAf 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

SEATTLE

L-1E

IAP

FRIDAY HARBOR

FRIDAY HARBOR (FHR)(KFHR) 0 SW UTC-8(-7DT) N48°31.32' W123°01.46'

113 B AOE NOTAM FILE FHR

RWY 16-34: H3402X75 (ASPH-GRVD) S-12.5 MIRL 0.8% up N

RWY 16: REIL, PAPI(P2R)—GA 4.0° TCH 43'. Bldg, Rgt tfc.

RWY 34: REIL, PAPI(P4R)—GA 3.5° TCH 42'. Trees, Rgt tfc.

SERVICE: S4 FUEL 100LL LGT ACTVT REIL Rwy 16 and 34; PAPI Rwy 16 and 34; MIRL Rwy 16-34—CTAF. Rwy 16 PAPI UNUSBL byd 3 degs right of cntrln.

NOISE: NS ABMTT procedures in effect ctc arpt mgr 360-378-4724. For noise abatement avoid tkfs bfn 0600-1500Z‡.

AIRPORT REMARKS: Attended Mon-Fri 1600-0100Z‡. No attendance during holidays. Bird activity on and invof arpt. Preferred Rwy 16 in calm wind cond. Due to high concentration of tfc invof arpt recommend ldg lfts or forward visibility lfts turned on while utilizing arpt. Acft with wingspan greater than 55', 24 hr PPR, ctc arpt mgr 360-378-4724 or cell 360-317-8674. Tsnt turbine acft prkg less than 1 hr durn lctd 250 ft S of trml ramp. Customs apron located on east side of terminal ramp. Soft ground bfn tiedowns NE parking area. Acft in excess of 7,500 lbs charged fee based on wt ctc arpt mgr for info. Lndg fees charged for airlines and charters.

AIRPORT MANAGER: (360) 378-4724

WEATHER DATA SOURCES: ASOS 135.675 (360) 378-8491.

COMMUNICATIONS: CTAf 128.25

® WHIDBEY APP/DEP CON 118.2

CLEARANCE DELIVERY PHONE: For CD ctc Whidbey Apch at 360-257-3310.

ADIO AIDS TO NAVIGATION: NOTAM FILE BLI.


WHATCOM (H) TACAN Chan 77 HUH (113.0) N48°56.72' W122°34.76' 195° 31.0 NM to fld. 82/20E.

TACAN AZIMUTH unusable:

155°-165° byd 15 NM bfo 6,000'

NDB (MW) 284 FHR N48°30.73' W123°01.43' at fld. 41/17E. NOTAM FILE FHR.

COMM/NAV/WEATHER REMARKS: 128.25 monitored intermittently.

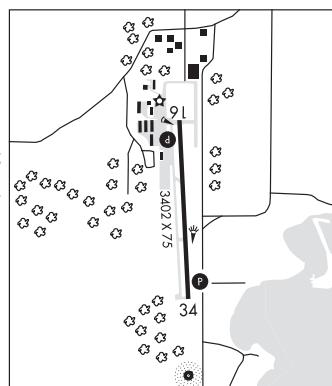

FRIDAY HARBOR SPB (W33) 0 NE UTC-8(-7DT) N48°32.24' W123°00.58'

SEATTLE

00 AOE NOTAM FILE SEA

WATERWAY 03W-21W: 10000X2000 (WATER)

WATERWAY 03W: Hill.

WATERWAY 12W-30W: 6000X1000 (WATER)

WATERWAY 12W: Hill.

WATERWAY 30W: Hill.

SEAPLANE REMARKS: Unattended. All tkfs should be performed N of Browns Island. Flight Notification Service (ADCUS) available. General aviation overnight ldg fee.

AIRPORT MANAGER: (360) 378-4724

COMMUNICATIONS: CTAf 128.25

CLEARANCE DELIVERY PHONE: For CD ctc Whidbey Apch at 360-257-3310.