

SHISHMAREF (SHH)(PASH) 1 S UTC-9(-8DT) N66°14.98' W166°05.36'

14 B NOTAM FILE SHH

RWY 05-23: H4997X73 (ASPH) S-12.5 MIRL

RWY 05: VASI(V4L)—GA 3.0° TCH 25'.

RWY 23: VASI(V4L)—GA 3.0° TCH 25'. Antenna.

SERVICE: LGT ACTVT MIRL Rwy 05-23—CTAF. VASI Rwy 05 and 23; on consly.

AIRPORT REMARKS: Unattended. Rwy cond unmnt; rcmd visual insp prior to Indg. NW-SE pvlg winds. Hvy acft sink in ramp blacktop on hot days. Max acft wgt; no lmt when frozen. Birds on and invof arpt 1 May-31 Oct. Rwy 05 markings faded. Rwy 23 markings faded.

AIRPORT MANAGER: 907-443-2500

WEATHER DATA SOURCES: AWOS-3P 121.1 (907) 649-4011. (WX CAM)

COMMUNICATIONS: CTAF 123.0

ANCHORAGE CENTER APP/DEP CON 119.2 263.0

RADIO AIDS TO NAVIGATION: NOTAM FILE TNC.

TIN CITY NDB/DME (HW) 347 TNC Chan 119(Y) N65°33.70'

W167°55.49' 037° 61.3 NM to fld. 248/10E.

NDB unusable:

200°-240° byd 20 NM

240°-330° byd 10 NM

DME unusable:

040°-050° byd 20 NM blo 6,000'

050°-080° byd 20 NM blo 9,000'

080°-090° byd 20 NM blo 8,500'

090°-095° byd 20 NM blo 5,500'

095°-110° byd 20 NM blo 4,400'

200°-240° byd 20 NM

240°-290° byd 5 NM

290°-320° byd 10 NM


320°-340° byd 20 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Nome FSS dial 1-800-478-8400. For a toll free call to Fairbanks FSS dial 1-866-248-6516.

NOME

H-1A, L-4H

IAP

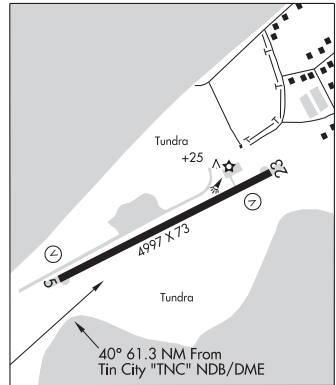

SHUNGNAK (SHG)(PAGH) 0 NW UTC-9(-8DT) N66°53.29' W157°09.75'

205 B NOTAM FILE SHG

RWY 10-28: 4001X60 (GRVL) MIRL

RWY 10: PAPI(P4R)—GA 3.0° TCH 35'. Brush.

RWY 28: Brush.

SERVICE: LGT ACTVT PAPI Rwy 10; MIRL Rwy 10-28—CTAF.

AIRPORT REMARKS: Unattended. Cold temperature airport. Altitude correction required at or below -32C. Rwy cond unmnt; rcmd visual insp bfr Indg. Rwy 10 uphill slope bfr apron entry. Rwy 10-28 water ponding durg rain. Rwy 10 and Rwy 28 mkd with lgts and plastic mkr.

AIRPORT MANAGER: 907-442-3147

WEATHER DATA SOURCES: AWOS-3P 118.525 (907) 560-7612. (WX CAM)

COMMUNICATIONS: CTAF 122.7

AMBLER RCO 122.0 (KOTZEBUE RADIO)

ANCHORAGE CENTER APP/DEP CON 119.2

RADIO AIDS TO NAVIGATION: NOTAM FILE OTZ.

KOTZEBUE (H) (H) VORW/DME 115.7 OTZ Chan 104 N66°53.14'

W162°32.40' 072° 127.2 NM to fld. 121/15E.

COMM/NAV/WEATHER REMARKS: For LC to Kotzebue FSS dial 907-442-3310. For a toll free call to Kotzebue FSS dial 1-800-478-7460. For a toll free call to Fairbanks FSS dial 1-866-248-6516.

FAIRBANKS

H-1A, L-4I

IAP

