

**HARBOR SPRINGS** (MGN)(KMG) 3 E UTC-5(-4DT) N45°25.53' W84°54.81'

LAKE HURON

686 B NOTAM FILE MGN

L-31B

RWY 10-28: H4149X75 (ASPH) S-22, D-30 MIRL

IAP

RWY 10: PAPI(P4R)—GA 3.5° TCH 28'. Thld dspcd 437'. Tree.

RWY 28: PAPI(P4L)—GA 4.0° TCH 35'. Thld dspcd 444'. Pole.

**SERVICE:** FUEL 100LL, JET A+ LGT ACTVT MIRL Rwy 10-28—CTAF.  
PAPI Rwy 10 and 28 opr consly. Rwy 28 PAPI unusable byd 2° left of centerline.

**NOISE:** Noise abatement procedures; no turbojet/turbofan acft depts frm 0400-1200Z±, no low flight ovr surrounding community, all acft depg to the W turn S ovr the water as soon as practical.

**AIRPORT REMARKS:** Attended 1300-dusk. Parachute Jumping. Birds and deer on and invof arpt. Rwy 10 apch area has two 70' lgtd obstruction poles 170' left of cntrln; +75' trees on N side. Rwy 28 apch area has lgtd obstruction poles, 165' left and 220' right of cntrln; 80' trees adj. Landing fee waived with minimum fuel purchase.

**AIRPORT MANAGER:** 231-206-9333

**WEATHER DATA SOURCES:** AWOS-3P 119.925 (231) 347-5231. Wind spd & drctn unrel btn 260-280°.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

® MINNEAPOLIS CENTER APP/DEP CON 134.6

**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.

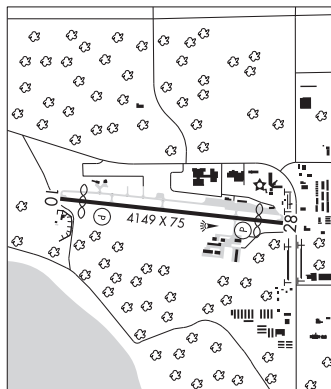
**RADIO AIDS TO NAVIGATION:** NOTAM FILE PLN.

PELLSTON (L) (L) VORTACW 111.8 PLN Chan 55 N45°37.84' W84°39.85' 227° 16.2 NM to fld. 836/6W.

VOR unusable:

301°-339°

GCP has azm only, no DME at GCP

**HARRIETTA****EAGLES LANDING** (4Y9) 3 W UTC-5(-4DT) N44°18.47' W85°46.30'

GREEN BAY

993 NOTAM FILE LAN

RWY 08-26: 2200X100 (TURF) 0.8% up E

RWY 08: Trees.

RWY 26: Trees.

**AIRPORT REMARKS:** Unattended. No snow removal. Lrg depression east of Rwy 26. Rwy 08-26 mkd with 3' yellow cones. 60' trees both sides of rwy 100' from rwy cntrln.

**AIRPORT MANAGER:** 586-944-7101

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.