

**CUSHING FLD LTD** (See NEWARK on page 74)

**DACY** (See HARVARD on page 62)

## DANVILLE

**VERMILION RGNL** (DENV)(KDNV) 4 NE UTC-6(-5DT) N40°11.99' W87°35.71'

697 B NOTAM FILE DNV

**RWY 03-21:** H6006X100 (ASPH-PFC) S-50, D-75, 2S-95 HIRL

0.8% up NE

**RWY 03:** VASI(V4L)—GA 3.0° TCH 41'. Tree.

**RWY 21:** MALSR. PAPI(P4L)—GA 3.0° TCH 46'.

**RWY 16-34:** H3999X100 (ASPH-GRVD) S-40, D-50 MIRL

0.6% up N

**RWY 16:** VASI(V2L)—GA 3.0° TCH 23'.

**RWY 34:** VASI(V2L)—GA 3.0° TCH 14'.

**RWY 12-30:** 2500X150 (TURF) 0.3% up NW

**SERVICE:** S4 FUEL 100LL, JET A LGT HIRL Rwy 03-21 preset low intst  
- to incr intst & ACTVT MALSR Rwy 21; VASI Rwys 03, 16 & 34; PAPI  
Rwy 21; MIRL Rwy 16-34—CTAF.

**AIRPORT REMARKS:** Attended 1300-0400Z†. Extv glider ops weekends. Rwy  
12-30 seasonal rwy Nov 1-May 1; Ctc amgr 217-442-4624. Air  
cargo Part 135 ft depts ngly 0400Z†, arrs dly 1200Z† Mon-Sat.

**AIRPORT MANAGER:** 217-442-4624

**WEATHER DATA SOURCES:** AWOS-3 119.275 (217) 442-4660.

**COMMUNICATIONS:** CTAF/UNICOM 122.7

Ⓡ **CHAMPAIGN APP/DEP CON** 121.35 (1200-0500Z† other times ctc)

Ⓡ **CHICAGO CENTER APP/DEP CON** 121.35

CLNC DEL 121.7

**CLEARANCE DELIVERY PHONE:** For CD if unable via radio ctc Champaign Apch at 217-355-4071, when Apch clsd ctc Chicago  
ARTCC at 630-906-8921


**RADIO AIDS TO NAVIGATION:** NOTAM FILE DNV.

**DANVILLE (L) TACAN** Chan 47 DNV (111.0) N40°17.63' W87°33.44' 195° 5.9 NM to fld. 699/2E.

**JULIP NDB (LOMW)** 332 DN N40°17.38' W87°31.80' 209° 6.2 NM to fld. 706/0E.

ILS 108.5 I-DNV Rwy 21. Class IE. LOM JULIP NDB. Unmonitored.

**CHICAGO**  
H-5E, L-27D  
IAP

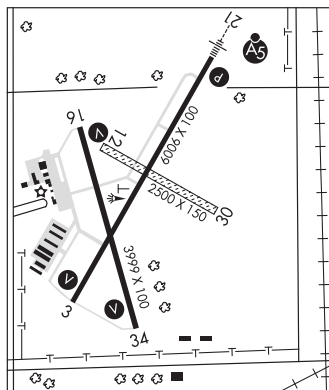

**DANVILLE** N40°17.63' W87°33.44' NOTAM FILE DNV.

(L) TACAN 111.0 DNV Chan 47 195° 5.9 NM to Vermilion Rgnl. 699/2E.

**CHICAGO**  
H-5E, 4H, L-27D

**DE KALB TAYLOR MUNI** (DKB)(KDKB) 2 E UTC-6(-5DT) N41°56.03' W88°42.34'

913 B NOTAM FILE DKB

**RWY 02-20:** H7026X100 (ASPH-GRVD) S-25, D-80 MIRL

**RWY 02:** MALSR. PAPI(P4L)—GA 3.0° TCH 53'. Railroad.

**RWY 20:** REIL. PAPI(P4L)—GA 3.0° TCH 29'.

**RWY 09-27:** H4201X75 (ASPH-GRVD) S-25, D-80 MIRL

**RWY 09:** REIL. PAPI(P4L)—GA 3.0° TCH 30'.

**RWY 27:** REIL. PAPI(P4L)—GA 3.0° TCH 24'. Tree.

**SERVICE:** S4 FUEL 100LL, JET A1+ OX 4 LGT MIRL Rwy 02-20  
preset low intst, to incr intst and ACTVT MIRL Rwy 09-27, PAPI Rwy  
09 and Rwy 27, REIL Rwys 09, 27 and 20; MALSR Rwy 02—CTAF.  
PAPI Rwy 02 and Rwy 20 operate 24 hrs.

**AIRPORT REMARKS:** Attended Nov-Feb 1400-2200Z†, Mar-Oct  
1400-2300+ . Fuel: 100LL 24 hr self serve with credit card.  
Prfered calm wind Rwy 02.

**AIRPORT MANAGER:** 815-748-8102

**WEATHER DATA SOURCES:** AWOS-3 119.075 (815) 748-2350.

**COMMUNICATIONS:** CTAF/UNICOM 122.7

Ⓡ **CHICAGO APP/DEP CON** 133.5

**CLEARANCE DELIVERY PHONE:** For CD ctc Chicago Apch at 847-289-0926.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE DPA.

**DUPAGE (VL) (L) VOR/DME** 114.55 DPA Chan 92(Y) N41°53.42'  
W88°21.01' 277° 16.1 NM to fld. 802/2E.

VOR unusable:

042°-047° byd 40 NM

ILS/DME 109.95 I-DJK Chan 36(Y) Rwy 02. Class IT. Unmonitored.

**CHICAGO**  
H-5E, L-28H  
IAP

