

BRANSON

BRANSON (BBG)(KBBG) 8 SSE UTC-6(-5DT) N36°31.92' W93°12.03'

KANSAS CITY
H-6I, L-16F
IAP, AD

1302 B Class I, ARFF Index A NOTAM FILE BBG
RWY 14-32: H7140X150 (CONC-GRVD) S-75, D-200, 2S-175,
 2D-350, 2D/2D2-700 PCR 510 R/C/W/T HIRL 0.7% up SE

RWY 14: REIL. PAPI(P4L)—GA 3.0° TCH 51'. Rgt tfc.
RWY 32: MALS.F. PAPI(P4L)—GA 3.0° TCH 50'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 14: TORA-7140 TODA-7140 ASDA-7140 LDA-7140
RWY 32: TORA-7140 TODA-7140 ASDA-7140 LDA-7140

SERVICE: FUEL 100LL, JET A, A+ LGT When ATCT clsd; ACTVT MALS.F
 Rwy 32; REIL Rwy 14; PAPI Rwy 14 and 32; HIRL Rwy 14-32—CTAF.

AIRPORT REMARKS: Attended continuously. Birds infov arpt. 100LL credit card self svc avbl H24 at GA apron. Arpt clsd to unsked ACR more than 30 pax seats exc 4 hr PPR—417-334-8002. PPR ACR more than 15 min bfr or aft sked arr or dep—amgr. Rwy 32 calm wind rwy. Hills and uneven trrn infov; trrn avoidance may actvt on fnl.

AIRPORT MANAGER: 417-334-7813

WEATHER DATA SOURCES: AWOS-2 124.625 (417) 334-0218.

COMMUNICATIONS: CTAF 128.15 ATIS 124.625 UNICOM 122.95

Ⓡ **SPRINGFIELD APP/DEP CON** 126.35

TOWER 128.15 (1300-0300Z±) **GND CON** 118.4 **CLNC DEL** 118.4 126.35 (when twr clsd)

AIRSPACE: CLASS D svc 1300-0300Z±; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE HRO.

HARRISON (VL) (L) VORW/DME 112.5 HRO Chan 72 N36°19.10' W93°12.80' 359° 12.8 NM to fld. 1400/4E.

DME unusable:

245°-260° byd 30 NM blo 4,500'

VOR unusable:

000°-086° byd 40 NM

087°-097° byd 40 NM blo 3,000'

087°-097° byd 55 NM

098°-166° byd 40 NM

165°-215° byd 20 NM blo 5,000'

165°-215° byd 30 NM blo 6,500'


167°-177° byd 40 NM blo 10,000'

167°-177° byd 69 NM

178°-250° byd 40 NM

300°-359° byd 40 NM

ILS/DME 111.35 I-BBG Chan 50(Y) Rwy 32. Unmonitored when twr clsd.

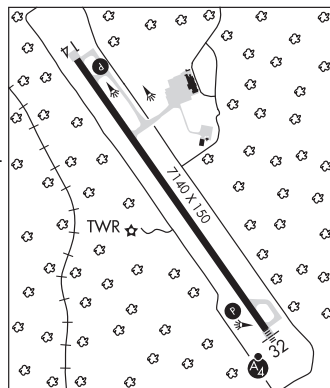

M GRAHAM CLARK DOWNTOWN (PLK)(KPLK) 1 S UTC-6(-5DT) N36°37.56' W93°13.74'

KANSAS CITY
L-16F
IAP

940 B NOTAM FILE COU

RWY 12-30: H3738X100 (ASP-GRVD) S-70, D-100 MIRL

RWY 12: REIL. Thld dspcd 289'.

RWY 30: REIL. VASI(V4R)—GA 3.0° TCH 52'. Thld dspcd 310'.

SERVICE: S2 FUEL 100LL, JET A+ LGT ACTVT REIL Rwy 12 and 30; VASI Rwy 30; MIRL Rwy 12-30—CTAF. Rwy 12 REIL located 105' from dthr. Rwy 30 REIL located 86' from dthr.

AIRPORT REMARKS: Attended 1300-2300Z±. Deer on and infov arpt. Student training activities in the area. General aviation svcs east end of airfield. No safety/overrun areas at rwy ends—large drop-offs. Steep terrain gradients along rwy pavement edges.

AIRPORT MANAGER: 417-332-1848

COMMUNICATIONS: CTAF/UNICOM 122.7

POINT LOOKOUT RCO 122.2 (COLUMBIA RADIO)

Ⓡ **SPRINGFIELD APP/DEP CON** 126.35

CLEARANCE DELIVERY PHONE: For CD ctc Springfield Apch at 417-868-5620/5619.

RADIO AIDS TO NAVIGATION: NOTAM FILE COU.

DOGWOOD (VL) (L) VORTAC 109.4 DGD Chan 31 N37°01.41' W92°52.62' 215° 29.2 NM to fld. 1600/1E.

VOR unusable:

032°-042° byd 40 NM

284°-294° byd 21 NM blo 12,000'

284°-294° byd 9 NM blo 6,000'

285°-296° byd 40 NM

