

MANCHESTER BOSTON RGNL (MHT)(KMHT) 3 S UTC-5(-4DT) N42°55.97' W71°26.15'

NEW YORK

266 B Class I, ARFF Index C NOTAM FILE MHT

H-11D, 12K, L-32H, 33D

RWY 17-35: H9250X150 (ASPH-GRVD) S-200, D-300, 2S-175, 2D-350 PCR 700 F/C/X/T

IAP, AD

HIRL CL

RWY 17: MALSR. TDZL. PAPI(P4R)—GA 3.1° TCH 67'. RVR-TMR Thld dsplcd 336'. Pole. 0.3% up.

RWY 35: ALSF2. TDZL. PAPI(P4L)—GA 3.0° TCH 68'. RVR-TMR Thld dsplcd 850'. Bldg. 0.8% down.

RWY 06-24: H7651X150 (ASPH-GRVD) S-200, D-300, 2S-175, 2D-350 PCR 700 F/C/X/T HIRL CL 0.3% up NE

RWY 06: REIL. PAPI(P4L)—GA 3.0° TCH 50'. RVR-TR Thld dsplcd 442'. Trees.

RWY 24: REIL. PAPI(P4L)—GA 3.0° TCH 50'. RVR-TR Trees.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 06: TORA-7650 TODA-7650 ASDA-7650 LDA-7208

RWY 17: TORA-9250 TODA-9250 ASDA-9250 LDA-8914

RWY 24: TORA-7650 TODA-7650 ASDA-6850 LDA-6850

RWY 35: TORA-9250 TODA-9250 ASDA-8500 LDA-7650

ARRESTING GEAR/SYSTEM

RWY 06: EMAS

SERVICE: S4 FUEL 100LL, JET A OX3 LGT Rwy 06 PAPI unusbl byd 6 degs R of cntrln.**NOISE:** Noise abatement procedures: turbojet acct should expect a right turn when departing Rwy 17.

AIRPORT REMARKS: Attended continuously. No touch and go ldg during snow removal opr. SAID in use. Operate transponders with altitude reporting mode and ADS-B (if equipped) enabled on all airport surfaces. Twy A safety area S of Twy E to Twy A2 is 65 ft. Jet acct taxiing w/ acrs Rwy 17-35 at Twy E must use ctn and low settings due to lgt acct prkg on the E ramp. No taxiing between pushed back acct and the airline terminal or cargo ramps. Acct not permitted to taxi between airline terminal bldg and acct that have pushed back or are taxiing on Twy G or Twy N. Air carrier acct only permitted to opr on airline terminal ramp. Air carriers excluded from Twy L. Acct with wingspan greater than 145' rstd from Twy G and Twy N. AMMON ramp rstd to acct with wingspan less than 118'. Acct are req to maintain taxilane centerline to avoid parked general aviation acct tiedowns. Acct with wingspan 118' or greater req ground crew assistance for taxi and parking. Lndg fee. User fee arpt.

AIRPORT MANAGER: 603-624-6539**WEATHER DATA SOURCES:** ASOS 119.55 (603) 626-6902. LAWR5.**COMMUNICATIONS:** ATIS 119.55 603-626-6902 UNICOM 122.95

® BOSTON APP/DEP CON 124.9

TOWER 121.3 GND CON 121.9 CLNC DEL 135.9

AIRSPACE: CLASS C svc ctc APP CON.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MHT.

(L) DME 114.4 MHT Chan 91 N42°52.11' W71°22.17' 323° 4.8 NM to fld. 470.

FITZY NDB (LOM/W) 209 MJ N42°51.85' W71°31.73' 060° 5.8 NM to fld. 234/15W.

ILS 109.95 I-MJE Rwy 06. Class II. LOM FITZY NDB.

ILS/DME 109.1 I-MNA Chan 28 Rwy 17. Class IE. DME also serves Rwy 35. DME unusable 10° right of course

ILS/DME 109.1 I-MHT Chan 28 Rwy 35. Class IIIE. DME also serves Rwy 17. DME unusable byd 30° left of course.

MOULTONBOROUGH (4MB) 1 NE UTC-5(-4DT) N43°46.05' W71°23.26'

NEW YORK

576 B NOTAM FILE BGR

L-32H

RWY 02-20: H3505X50 (ASPH) S-8 RWY LGTS(NSTD)

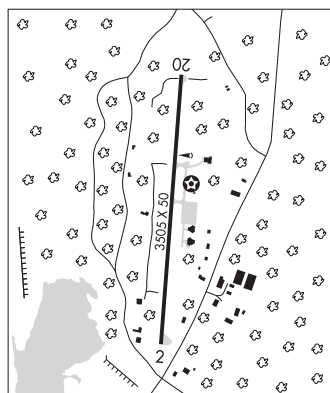
RWY 02: Trees.

RWY 20: Trees.

SERVICE: S4 FUEL 100LL LGT ACTVT rotg bcn—CTAF. 5 clicks on, 3 clicks off. ACTVT non-std LIRL Rwy 02-20—CTAF. 5 clicks on, 3 clicks off. Rwy 02-20 non-std LIRL, lgts are 4 ft high. Lgtd only btr dthrs, vrb spacing, 2890 ft of rwy lgtd. Wind indcr cont lgtd dusk-dawn.

AIRPORT REMARKS: Attended May-Oct Mon-Fri ireg, Sat-Sun ireg.

Oct-May by appointment. Wildlife on & invof arpt. Overfly rwy to check for wildlife. VFR only. Nmrs non-radio equipped acct oprg fm airfld. Rwy 02 pline mkr faded. 24 hr self svc fuel avbl with credit card. Rwy 02 designated calm wind rwy. Rwy end 02 dthr area markings non-std size & spacing. Rwy 02-20 non-std cntrln size & spacing. Dthr not mkd. Float plane access to and fm Berry Pond.

AIRPORT MANAGER: 508-479-8301**COMMUNICATIONS:** CTAF/UNICOM 122.8**CLEARANCE DELIVERY PHONE:** For CD ctc Boston ARTCC at 603-879-8659.**MOUNT WASHINGTON RGNL** (See WHITEFIELD on page 157)