

RICHMOND/ASHLAND

HANOVER CO MUNI (OFP)(KOPF) 8 N UTC-5(-4DT) N37°42.54' W77°26.20'

WASHINGTON
H-10H, 12I, L-34E, 36H
IAP

207 B TPA-1007(800) NOTAM FILE OFF

RWY 16-34: H5402X100 (ASPH-GRVD) S-54, D-70, 2D-119

PCR 210 F/D/X/T HIRL

RWY 16: REIL. PAPI(P4L)—GA 3.0° TCH 40'. Tree.

RWY 34: REIL. PAPI(P4L)—GA 3.0° TCH 50'. Trees.

SERVICE: S4 FUEL 100LL, JET A OX 1, 2, 3, 4 LGT ACTVT REIL

Rwys 16 & 34; PAPI Rwy 16 and 34; HIRL Rwy 16-34—CTAF.

NOISE: Noise sensitive area S of arpt.

AIRPORT REMARKS: Attended 1200-0000Z±. Deer and birds on and invof arpt. For arpt svcs call 804-798-6500. Acft on apch to KRIC Rwy 16 xng ovr arpt. Rwy 34 preferred rwy with wind less than 5 kts.

AIRPORT MANAGER: 804-365-6208

WEATHER DATA SOURCES: ASOS 119.025 (804) 752-2902.

COMMUNICATIONS: CTAF/UNICOM 122.7

Ⓡ **POTOMAC APP/DEP CON** 126.4 (001°-185°) 126.75 (186°-360°)

118.2

CLNC DEL 125.4

CLEARANCE DELIVERY PHONE: For CD ctc Potomac Apch at 866-640-4124.

RADIO AIDS TO NAVIGATION: NOTAM FILE RIC.

RICHMOND (H) (H) VORTACW 114.1 RIC Chan 88 N37°30.14'

W77°19.22' 345° 13.6 NM to fld. 158/9W.

TACAN AZIMUTH unusable:


060°-075° byd 10 NM blo 1,700'

340°-350° byd 9 NM

VOR unusable:

013°-023° byd 9 NM blo 2,000'

LOC/DME 109.7 I-OPF Chan 34 Rwy 16. LOC unmonitored when arpt unatndd.

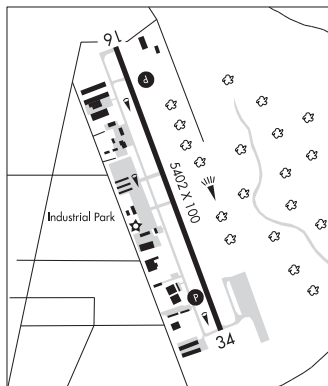

RICHMOND N37°30.14' W77°19.22' NOTAM FILE RIC.

WASHINGTON
H-10H, 12H, L-34E, 36H

(H) (H) VORTACW 114.1 RIC Chan 88 at Richmond Intl. 158/9W.

TACAN AZIMUTH unusable:

060°-075° byd 10 NM blo 1,700'

340°-350° byd 9 NM

VOR unusable:

013°-023° byd 9 NM blo 2,000'

RCO 122.4 (LEESBURG RADIO)