

**ARLINGTON MUNI** (AWO)(KAWO) 3 SW UTC-8(-7DT) N48°09.65' W122°09.54'

SEATTLE  
H-1B, L-1E  
IAP, AD

142 B TPA—See Remarks NOTAM FILE AWO

**RWY 16-34:** H5332X100 (ASPH) S-114, D-150, 2S-175, 2D-270 MIRL 0.3% up N

**RWY 16:** REIL. PAPI(P2L)—GA 3.0° TCH 40'. Tree. Rgt tfc.

**RWY 34:** MALS. PAPI(P2L)—GA 3.0° TCH 36'.

**RWY 11-29:** H3498X75 (ASPH) S-32, D-34, 2D-59

**RWY 11:** REIL. PAPI(P2L)—GA 3.5° TCH 42'. Rgt tfc.

**RWY 29:** REIL. PAPI(P2L)—GA 4.0° TCH 40'. Tree.

**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** REIL Rwy 11 and 29 opr SS-SR; PAPI Rwy 11, 16, 29 and 34 opr consly. ACTVT MALS Rwy 34; REILS Rwy 16; Rwy 16-34 edge lights; twy lgts—CTAF.

**AIRPORT REMARKS:** Attended Mon-Fri 1600-0100Z $\ddagger$ . Fuel, phone 360-435-5700 for after hrs svc. 100LL fuel avbl 24 hr credit card svc. Alternate phone number for arpt: 360-403-3470. Wildlife on and invof arpt. Winter wx ops and reporting Monday-Fri 1600-0100Z $\ddagger$ . Rwy 34 calm wind rwy. Glider ops at arpt daily. Glider turf parallel east of Rwy 16-34, full length dimensions 3450 x 145 ft. Rwy 11-29 turf lctd btn D2 and D3 dimensions 1400 x 100 ft. Ultralight and powered parachute ops daily west of Rwy 16-34. TPA—1200(1058). TPA for ultralights 542(400), helicopters 642(500). For admln details & rules on local procs call 360-403-3470.

**AIRPORT MANAGER:** 360-403-3471

**WEATHER DATA SOURCES:** AWOS-3PT 135.625 (360) 435-8045.

**COMMUNICATIONS:** CTAF 122.725

Ⓡ SEATTLE APP/DEP CON 128.5

CLNC DEL 121.725

**CLEARANCE DELIVERY PHONE:** For CD when ATCT is clsd ctc Seattle Apch at 206-214-4722.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE PAE.

**PAINE (L) (L) VORW/DME** 110.6 PAE Chan 43 N47°55.19' W122°16.67' 358° 15.2 NM to fld. 669/20E.

**WATON NDB (LOMW)** 382 AW N48°04.57' W122°09.23' 341° 5.1 NM to fld. 65/17E. NOTAM FILE AWO.

**LOC** 111.5 I-AWO Rwy 34. LOM WATON NDB. LOC unmonitored cont.

**AUBURN MUNI** (S50) 1 N UTC-8(-7DT) N47°19.66' W122°13.60'

SEATTLE  
L-1D  
IAP, AD

63 B NOTAM FILE SEA

**RWY 17-35:** H3842X75 (ASPH) S-12.5 MIRL

**RWY 17:** REIL. PAPI(P2L)—GA 4.0° TCH 43'. Thld dspcd 200'. Bldg. Rgt tfc.

**RWY 35:** REIL. PAPI(P2R)—GA 4.0° TCH 57'. Thld dspcd 241'. Tn prkg lot lgt poles..

**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** PCL avbl 24-7. ACTVT REIL Rwy 17 and 35; MIRL Rwy 17-35—CTAF. PAPI Rwy 17 and 35 opr consly. Rwy 17 PAPI unusble byd 10 degs right of cntrln.

**NOISE:** Ultralight NA. OTFC of residential area E of arpt NA. Tfc pat instrn—amgr. Ref arpt website for pat info and noise abatement.


**AIRPORT REMARKS:** Attended Mon-Fri 1600-0100Z $\ddagger$ . Birds and wildlife invof arpt. Credit card self svc fuel avbl H24. Fuel svc—206-767-5290. Winter wx rpt Mon-Fri 1600-0100Z $\ddagger$ . Hel touchdown running ldg and tkofs prohibited on Twy A and Rwy 17-35. Rwy 35 calm wnd rwy. Avoid rwy DLA when pat actv.

**AIRPORT MANAGER:** (253) 333-6821

**COMMUNICATIONS:** CTAF/UNICOM 122.975

Ⓡ SEATTLE APP/DEP CON 123.85

CLNC DEL 123.85

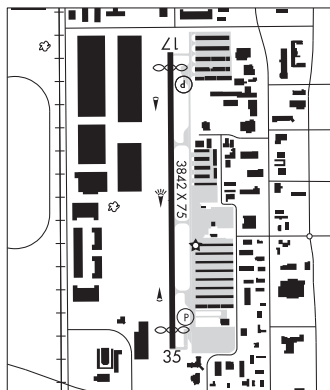

CONTINUED ON NEXT PAGE

## CONTINUED FROM PRECEDING PAGE

**CLEARANCE DELIVERY PHONE:** For CD ctc Seattle Apch at 206-214-4723.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE SEA.

**SEATTLE (VH) (H) VORTACW** 116.8 SEA Chan 115 N47°26.12' W122°18.58' 133° 7.3 NM to fld. 348/19E.

VOR unusable:

002°-010° byd 40 NM  
 008°-023° byd 20 NM blo 3,500'  
 008°-023° byd 30 NM blo 4,100'  
 037°-047° byd 40 NM blo 12,000'  
 037°-047° byd 46 NM blo 18,000'  
 048°-066° byd 40 NM  
 067°-077° byd 40 NM blo 12,000'  
 067°-077° byd 56 NM blo 18,000'  
 078°-110° byd 40 NM  
 125°-130° byd 40 NM  
 233°-273° byd 20 NM blo 8,000'  
 233°-273° byd 30 NM blo 10,000'  
 233°-273° byd 35 NM blo 11,000'  
 233°-273° byd 8 NM blo 5,500'  
 250°-275° byd 40 NM  
 276°-286° byd 40 NM blo 10,000'  
 276°-286° byd 60 NM  
 287°-292° byd 40 NM  
 303°-333° byd 20 NM blo 2,900'  
 303°-333° byd 30 NM blo 4,000'  
 305°-315° byd 40 NM blo 5,000'

DME unusable:

008°-028° byd 20 NM blo 4,500'  
 008°-028° byd 30 NM blo 7,000'  
 203°-219° byd 27 NM  
 220°-225° byd 20 NM  
 226°-239° byd 27 NM  
 240°-253° byd 15 NM  
 303°-008° byd 30 NM blo 3,500'

TACAN AZIMUTH unusable:

008°-163°  
 303°-008° byd 30 NM blo 3,500'

VOR unusable:

305°-315° byd 47 NM blo 5,400'  
 305°-315° byd 55 NM  
 316°-327° byd 40 NM blo 18,000'  
 328°-359° byd 40 NM  
 333°-353° byd 15 NM blo 3,500'  
 353°-008° byd 20 NM blo 2,900'

**COMM/NAV/WEATHER REMARKS:** Wx report avbl, key mic 4 times on freq 122.8.

**AULT FLD** (See WHIDBEY ISLAND NAS (AULT FLD) on page 286)

**AVEY FLD** (See LAURIER on page 244)

**BADGER MOUNTAIN** N47°35.29' W120°08.60'  
**RCO** 122.3 (SEATTLE RADIO)

SEATTLE  
 L-1D, 9A

**BANDERA STATE** (4WØ) 0 W UTC-8(-7DT) N47°23.72' W121°32.19'

SEATTLE

1636 NOTAM FILE SEA

**RWY 08-26:** 2344X100 (TURF)

**RWY 08:** Trees.

**RWY 26:** Trees.

**AIRPORT REMARKS:** Unattended. Arpt CLOSED 1 Oct-1 June exc for apvd mil and public safety/law enforcement helicopter ops.

Rwy 08-26 west end extremely rough, rwy soft when wet. Vehicles, pedestrians and animals on and invof rwy. Ctc WA State Aviation Division 360-709-8015 or 1-800-552-0666 WA area for facility info prior to use. For acft accidents/incidents ctc WA state emergency operations center 800-258-5990. Rwy marked with reflectors dur dates arpt is open.

**AIRPORT MANAGER:** (360) 618-2477

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD when ATCT is clsd ctc Seattle Apch at 206-214-4722.