

## CONTINUED FROM PRECEDING PAGE

## AIRSPACE: CLASS E.

## RADIO AIDS TO NAVIGATION: NOTAM FILE LAR.

(VL) (L) VOR/DME 117.6 LAR Chan 123 N41°20.27' W105°43.26' 113° 2.6 NM to fld. 7299/14E.

## VOR unusable:

015°-049° byd 40 NM  
 050°-062° byd 40 NM blo 12,000'  
 050°-062° byd 53 NM blo 18,000'  
 063°-080° byd 40 NM  
 081°-091° byd 22 NM blo 18,000'  
 092°-119° byd 40 NM  
 120°-130° byd 40 NM blo 11,000'  
 120°-130° byd 51 NM  
 170°-180° byd 40 NM blo 15,600'  
 170°-180° byd 55 NM  
 181°-216° byd 40 NM  
 217°-227° byd 40 NM blo 13,300'  
 217°-227° byd 49 NM  
 228°-232° byd 40 NM  
 233°-243° byd 40 NM blo 23,000'  
 244°-267° byd 40 NM  
 268°-278° byd 40 NM blo 12,200'  
 268°-278° byd 49 NM  
 279°-285° byd 40 NM

**LUSK MUNI** (LSK)(KLSK) 3 E UTC-7(-6DT) N42°45.23' W104°24.27'  
 4967 B NOTAM FILE CPR

**CHEYENNE**  
 H-5A, L-12F

RWY 10-28: H5058X75 (ASPH) S-12.5 MIRL

RWY 10: PAPI(P2L)—GA 3.0° TCH 40'. Pole.

RWY 28: REIL. PAPI(P2L)—GA 3.0° TCH 40'.

**SERVICE:** FUEL 100LL LGT ACTVT REIL Rwy 28; PAPI Rwy 10 and  
 Rwy 28; MIRL Rwy 10-28-122.8.

**AIRPORT REMARKS:** Unattended. Fuel avbl via credit card reader.**AIRPORT MANAGER:** 307-334-3622**WEATHER DATA SOURCES:** AWOS-3PT 118.350 (307) 334-4028.**COMMUNICATIONS:** CTAF/UNICOM 122.8

RCO 122.3 (CASPER RADIO)


**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Denver  
 ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE DGW.

**HIPSHER (VL) (DH) VOR/DME** 115.75 IIP Chan 104(Y)  
 N42°40.57' W105°13.57' 070° 36.6 NM to fld.  
 4906/12E.

## VOR unusable:

165°-309° byd 40 NM  
 310°-320° byd 40 NM blo 8,300'  
 310°-320° byd 53 NM  
 321°-334° byd 40 NM  
 335°-345° byd 40 NM blo 7,500'  
 335°-345° byd 56 NM  
 346°-040° byd 40 NM

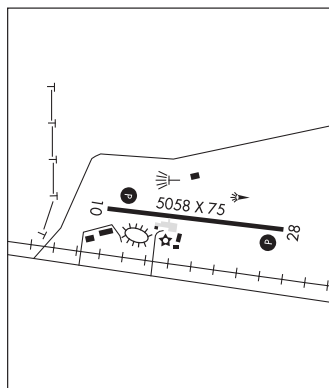

**MEDICINE BOW** (8ØV) 2 SE UTC-7(-6DT) N41°53.04' W106°10.97'

**CHEYENNE**

6658 NOTAM FILE CPR

RWY 10-28: 3170X80 (TURF-DIRT)

RWY 06-24: 2680X50 (TURF-DIRT)

**AIRPORT REMARKS:** Unattended. Wildlife invof all rwys. Rwy 06-24 is no longer maintained. Rwy 06-24, 9 to 12 inch berms  
 both sides of rwy. Rwy 10-28 graded. Gopher holes on rwy sfcs, rwys very soft when wet. Rwy 10-28 1' ditch south of  
 rwy. Rwy 06-24 rough and uneven full length, numerous gopher and badger holes. Rwy 10-28 marked with yellow 3' x  
 2' cones. Thld markings skewed at angle to Rwy 06-24.

**AIRPORT MANAGER:** 307-703-0418**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Denver ARTCC at 303-651-4257.