

BRIDGER MUNI (6S1) 0 W UTC-7(-6DT) N45°17.50' W108°55.54'

BILLINGS
L-13D

3720 B NOTAM FILE GTF

RWY 16-34: H3400X42 (ASPH) S-4 LIRL(NSTD)

RWY 16: Thld dsplcd 120'. Tree.

RWY 34: PAPI(P2L)—GA 3.0°. Thld dsplcd 475'. Road. Rgt tfc.

SERVICE: LGT ACTIVATE LIRL Rwy 16-34, PAPI Rwy 34—CTAF.

AIRPORT REMARKS: Unattended. Deer and waterfowl on and invof arpt. Rwy 16 thld relocated 120' for ngt ops only not marked. Rwy 34 dthr mkd by nrs; 2880 ft avbl for night ops. Rwy 16-34 NSTD LIRL. West side 57' from pavement edge, East side 47' from pavement edge. Each thld has 4 lgts total.

AIRPORT MANAGER: 406-662-3505

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Billings Apch at 406-255-2798

RADIO AIDS TO NAVIGATION: NOTAM FILE BIL.

BILLINGS (VH) (H) VORTACW 114.5 BIL Chan 92 N45°48.51' W108°37.48' 188° 33.5 NM to fld. 3811/14E.


VOR unusable:

146°-154° byd 40 NM

155°-165° byd 40 NM blo 11,000'

155°-165° byd 49 NM blo 18,000'

166°-173° byd 40 NM

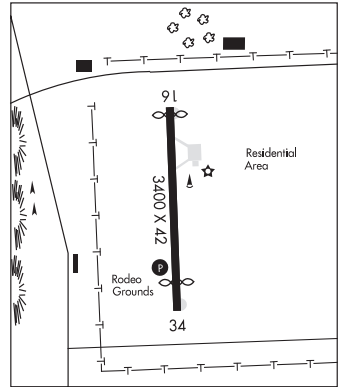

BROADUS (ØØF) 3 NW UTC-7(-6DT) N45°28.23' W105°27.43'

BILLINGS
L-13E

3282 B NOTAM FILE GTF

RWY 10-28: H4400X75 (ASPH) S-12.5 MIRL 0.4% up W

RWY 10: PAPI(P2L)—GA 3.0° TCH 25'. Rgt tfc.

RWY 28: PAPI(P2L)—GA 3.0° TCH 25'.

SERVICE: FUEL 100LL, JET A LGT MIRL Rwy 10-28, PAPI Rwy 10 and

Rwy 28 opr dusk-1700, after 1700 ACTIVATE—CTAF.

AIRPORT REMARKS: Unattended.


AIRPORT MANAGER: 406-853-6448

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Salt Lake ARTCC at 801-320-2568.

RADIO AIDS TO NAVIGATION: NOTAM FILE MLS.

MILES CITY (VH) (DH) VORW/DME 112.1 MLS Chan 58 N46°22.93' W105°57.21' 150° 58.5 NM to fld. 2666/9E.

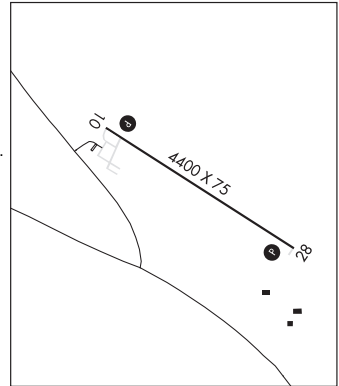

BROADWATER CO (See TOWNSEND on page 148)