

ONEIDA

SCOT MUNI (SCX)(KSCX) 4 SW UTC-5(-4DT) N36°27.34' W84°35.15'

CINCINNATI
H-9A, L-25A
IAP

1545 B NOTAM FILE BNA

RWY 05-23: H5505X75 (ASPH) S-20.5 PCN 7 F/C/X/T MIRL

0.4% up SW

RWY 05: REIL. PAPI(P4L)—GA 3.5° TCH 44'. Trees.

RWY 23: ODALS. REIL. PAPI(P4L)—GA 3.0° TCH 42'. Trees.

SERVICE: S4 FUEL 100LL, JET A+ OX 1, 4 LGT ACTVT ODALS Rwy 23; REIL Rwy 05 & 23; MIRL Rwy 05-23—CTAF. MIRL Rwy 05-23 preset low instst; incr instst—CTAF. PAPI Rwy 05 & 23 opr consly.

AIRPORT REMARKS: Attended Mon-Sat 1300-2300Z†, Sun 1730-2300Z†.

Aft hr—423-223-4331. Unatndd Thanksgiving & Christmas. Wildlife on and invof arpt. Fuel 24 hr credit card svc avbl.

AIRPORT MANAGER: 423-569-8270

WEATHER DATA SOURCES: AWOS-3 135.025 (423) 569-6651.

COMMUNICATIONS: CTAF/UNICOM 122.8

® **INDIANAPOLIS CENTER APP/DEP CON** 124.625

CLEARANCE DELIVERY PHONE: For CD ctc Indianapolis ARTCC at 317-247-2411.


RADIO AIDS TO NAVIGATION: NOTAM FILE BNA.

LIVINGSTON (VL) (L) VOR/DME 114.35 LVT Chan 90(Y)

N36°35.07' W85°10.00' 107° 29.1 NM to fld. 1020/2W.

DME unusable:

034°-056° byd 35 NM

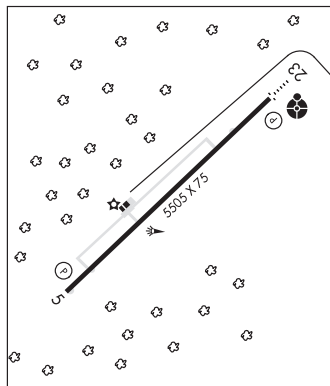

OUTLAW FLD (See CLARKSVILLE on page 428)

PARIS

HENRY CO (PHT)(KPHT) 3 NW UTC-6(-5DT) N36°20.16' W88°23.07'

ST LOUIS
H-6J, L-16I
IAP

580 B NOTAM FILE MKL

RWY 02-20: H5001X100 (ASPH) S-27 PCN 10 F/D/X/T MIRL

RWY 02: REIL. PAPI(P4L)—GA 3.0° TCH 26'.

RWY 20: REIL. PAPI(P4L)—GA 3.0° TCH 21'.

SERVICE: FUEL 100LL, JET A+ LGT REIL Rwy 02-20, MIRL Rwy 02-20 opr dusk-dawn. PAPI Rwy 02-20 opr consly. Rwy 02 PAPI unusbl byd 8° right and 8° left of cntrln. Rwy 20 PAPI unusbl byd 9° right of cntrln. Parallel twy is unlgtd.

AIRPORT REMARKS: Attended Mon-Fri 1400-2230Z†. Arpt unatndd Thanksgiving; Christmas; New Years and federal holidays. Ultralights are not to cross Rwy 02-20.

AIRPORT MANAGER: 731-644-7933

WEATHER DATA SOURCES: AWOS-3 118.825 (731) 644-0451.

COMMUNICATIONS: CTAF/UNICOM 123.0

® **MEMPHIS CENTER APP/DEP CON** 134.65

CLEARANCE DELIVERY PHONE: For CD ctc Memphis ARTCC at 901-368-8453/8449.

RADIO AIDS TO NAVIGATION: NOTAM FILE MKL.

MC KELLAR (VL) (DH) VOR/DME 114.85 MKL Chan 95(Y)

N35°36.21' W88°54.63' 031° 50.8 NM to fld. 410/1W.

VOR unusable:

000°-018° byd 47 NM

019°-041° byd 40 NM

042°-052° byd 38 NM blo 5,100'

043°-104° byd 40 NM

070°-104° byd 25 NM blo 5,000'

105°-125° byd 40 NM

126°-205° byd 25 NM blo 5,000'

126°-297° byd 40 NM

232°-266° byd 25 NM blo 2,200'

280°-290° byd 22 NM blo 5,100'

349°-359° byd 40 NM

DME unusable:

042°-052° byd 38 NM blo 5,100'

070°-104° byd 25 NM blo 5,000'

105°-125°

126°-205° byd 25 NM blo 5,000'

232°-266° byd 25 NM blo 2,200'

280°-290° byd 22 NM blo 5,100'

