

**LAKESIDE MUNI** (9S3) 0 NW UTC-8(-7DT) N43°34.99' W124°10.82'  
 20 NOTAM FILE MMV  
**RWY 15-33:** 2150X100 (TURF)

**KLAMATH FALLS**

**RWY 15:** Trees.  
**RWY 33:** Trees.

**AIRPORT REMARKS:** Unattended. Wildlife on and invof arpt. Remote ctl acct oprns at arpt. Rwy 15-33 rwy ends marked with white mats. To deactivate sprinklers key 122.9.

**AIRPORT MANAGER:** (209) 327-1578

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Seattle ARTCC at 253-351-3694.

**LAKEVIEW**

**LAKE CO** (LKV)(KLV) 3 SW UTC-8(-7DT) N42°09.67' W120°23.95'  
 4734 B NOTAM FILE LKV  
**RWY 17-35:** H5318X100 (ASPH) S-74, D-86 MIRL

**KLAMATH FALLS**  
**H-3B, L-11A**  
**IAP**

**RWY 17:** REIL. PAPI(P4R)—GA 3.0° TCH 45'.

**RWY 35:** REIL. PAPI(P4L)—GA 3.0° TCH 45'.

**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** ACTIVATE MIRL Rwy 17-35; PAPI Rwy 17 and Rwy 35; REIL Rwy 17 and Rwy 35—CTAF.

Tetrahedron lighting inop.

**AIRPORT REMARKS:** Attended Apr-Sep 1700-0000Z†, Oct-Mar 1500-0100Z†. Flocks of large waterfowl in vcnty Nov-May. Wildlife on and invof arpt. Extv airtanker ops in fire season. Possible glider ops on twy. Drag strip oriented NW-SE lctd 3000' southwest of Rwy 35. Twy NE-SW used for strong cross wind ldg. Cold temperature airport. Altitude correction required at or below -26C.

**AIRPORT MANAGER:** 541-947-4222

**WEATHER DATA SOURCES:** AWOS-3PT 135.525 (541) 947-5069.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**RCO** 122.3 (MC MINNVILLE RADIO)

Ⓡ **SEATTLE CENTER APP/DEP CON** 127.6


**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Seattle ARTCC at 253-351-3694.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE LKV.

**LAKEVIEW (VH) (H) VORTACW** 112.0 LKV Chan 57 N42°29.57' W120°30.43' 147° 20.5 NM to fld. 7465/19E.

VOR unusable:

- 120°-142° byd 40 NM
- 143°-153° byd 117 NM
- 143°-153° byd 40 NM blo 11,000'
- 143°-153° byd 65 NM blo 14,000'
- 154°-160° byd 40 NM
- 161°-171° byd 40 NM blo 18,000'
- 172°-208° byd 40 NM
- 209°-219° byd 40 NM blo 9,000'
- 209°-219° byd 63 NM
- 220°-224° byd 40 NM
- 225°-236° byd 40 NM blo 15,000'
- 225°-236° byd 48 NM
- 237°-248° byd 40 NM
- 249°-259° byd 40 NM blo 12,000'
- 249°-259° byd 56 NM
- 260°-280° byd 40 NM

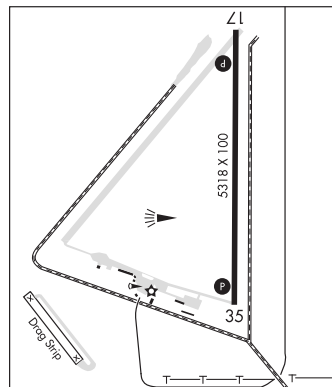

**LARK'S LDG SPB** (See ONTARIO on page 196)

**LEBANON STATE** (S30) 1 SW UTC-8(-7DT) N44°31.87' W122°55.78'  
 349 B NOTAM FILE MMV  
**RWY 16-34:** H2747X60 (ASPH) MIRL

**SEATTLE**

**RWY 16:** PAPI(P2L)—GA 3.5° TCH 40'. Tree.

**RWY 34:** PAPI(P2L)—GA 3.0° TCH 44'. Thld dsplcd 260'. Road.

**SERVICE:** S4 **FUEL** 100LL, MOGAS **LGT** ACTVT PAPI RWY 16 & 34; MIRL RWY 16-34—CTAF.

**AIRPORT REMARKS:** Attended continuously. Acft departing Rwy 34 make 10° left turn after tkf as soon as safety permits.

**AIRPORT MANAGER:** 503-378-4880

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**CLEARANCE DELIVERY PHONE:** For CD ctc Cascade Apch at 541-607-4674/4675, when Apch clsd ctc Seattle ARTCC at 253-351-3694.